


Front Passenger Interior Door Assist Grip Cover Loose

Service Category Vehicle Interior

Section Interior Panels/Trim

Market USA

Lexus Supports
ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2011 – 2013	CT200H	

REVISION NOTICE

July 31, 2013 Rev1:

- Applicability has been updated to include 2012 – 2013 model year CT 200h vehicles.
- The Introduction, Warranty Information, Parts Information, and Repair Procedure sections have been updated.

Any previous printed versions of this bulletin should be discarded.

Introduction

Some 2011 – 2013 model year CT 200h vehicles may exhibit a condition where the front passenger interior door assist grip cover (door pull) becomes loose from the door panel. A newly designed front passenger interior door assist grip cover, 2 retaining clips, and repair procedure have been developed to address this condition. Please follow the procedure in this bulletin to install the updated door assist grip cover.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VIN shown below.

MODEL	PRODUCTION CHANGE EFFECTIVE VIN
CT 200h	JTHKD5BH#D2147732

Front Passenger Interior Door Assist Grip Cover Loose

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
BD1117	Replace Door Assist Grip Cover	0.3	74645-76010-C1	62	14

APPLICABLE WARRANTY

- This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

PART NUMBER		PART NAME	QTY
PREVIOUS	NEW		
74645-76010-C1	74645-76020-C0	Cover, Door Assist Grip, RH – Black	1
67771-76010			2

Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Plastic Pry Tool Set*	<u>00002-06020-02</u>	1

* Essential SST.


NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

Repair Procedure

1. Confirm that the door assist grip cover is loose.
 - A. If the door assist grip cover is loose, proceed to step 2 for door assist cover replacement.
 - B. If the door assist grip cover is not loose, this bulletin does not apply.

Figure 1.

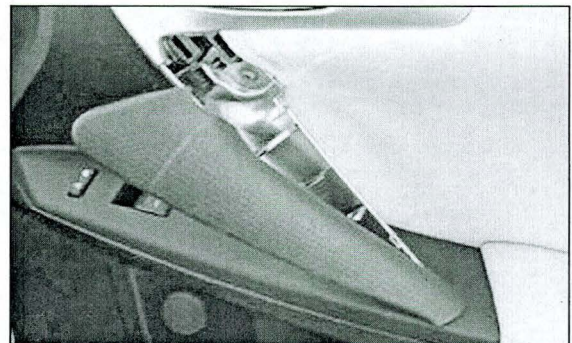

Front Passenger Interior Door Assist Grip Cover Loose


Repair Procedure (Continued)

2. Remove the passenger assist grip cover.

Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:


- 2011 / 2012 / 2013 CT 200h:
*Vehicle Exterior – Door/Hatch – “Door/Hatch:
Front Door: Disassembly”*

Figure 2.

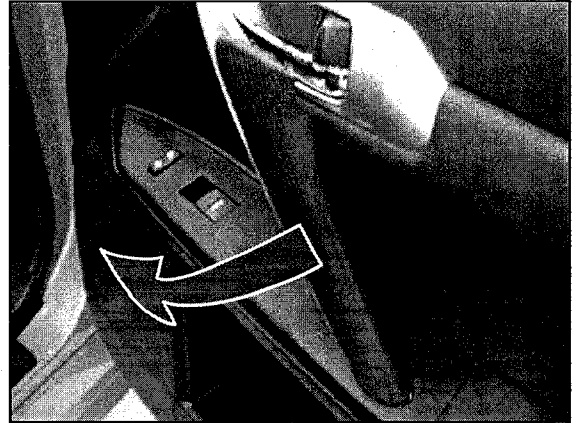

3. On the new part, install the 2 retainers on the plastic holders as shown.

Figure 3.

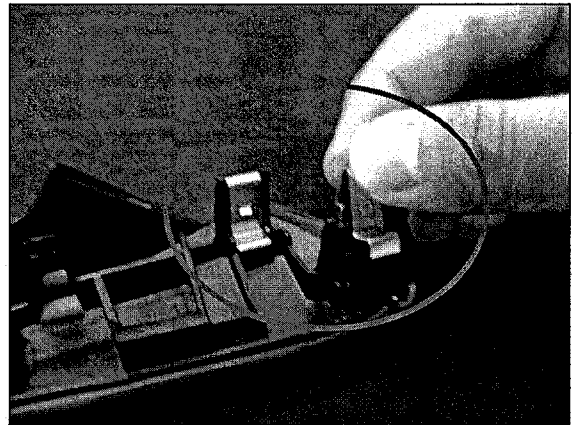

Front Passenger Interior Door Assist Grip Cover Loose


Repair Procedure (Continued)

4. Install the assist grip cover.

Refer to TIS, applicable model and model year Repair Manual:

- 2011 / 2012 / 2013 CT 200h:
*Vehicle Exterior – Door/Hatch – “Door/Hatch:
Front Door: Reassembly”*

Figure 4.

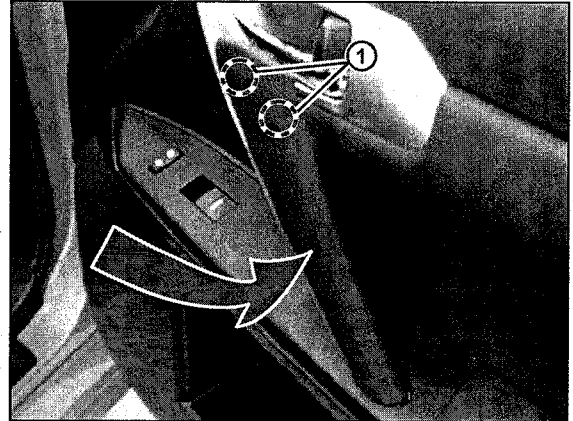

1	Click Sound
---	-------------

5. Confirm the click sound from the two clips when the assist grip cover is installed in the door trim panel.