



Subject:	Improper Engine Block Heater (Option K05) Usage - Continuous Power
Affected:	Chevrolet Express Cut-away Vans Chevrolet Silverado Chassis Cab GMC Savana Cut-away Vans GMC Sierra Chassis Cab Upfitted as an Ambulance (YF2) 2003 and beyond
	July 16, 2014
	•
Revision Date:	July 16, 2014

ADVISORY:

This bulletin refers to General Motors Service Information Bulletin (TBD) – GM Dealers should refer to the bulletin for more information.

Condition/Concern:

General Motors has identified vehicles with the optional Engine Block Heater (Option Code K05), standard on all Duramax Diesel engines, where the fleet customer, dealer, or secondary vehicle manufacturers/upfitters have plugged the engine block heater into an on-board "AC" power source providing continuous 110v power to the heater resulting in electrical failure, shorting of wires, overheating of the system, and possibly engine compartment fires.

Specifically, fleet customers, dealers, and secondary vehicle manufacturers/upfitters for ambulance bodies are reminded that the Engine Block Heater usage is only for inclement weather conditions specific to assisting with cold weather starts – not for continual usage or usage during non-cold weather conditions.

Repair/Recommendation:

As shipped from GM, the available Engine Block Heater Cord is furled up and attached under hood as illustrated in Figure 1 (item #2 & #3).

Fleet customers, dealers, and secondary vehicle manufacturers/upfitters are reminded that the Regular Production Option (RPO) K05 Block Heater is to be used for Intermittent Cold Ambient starts when the outside temperature is between -18 degrees C (-0 degrees F) and - 29 degrees C (-20 degree F) – not to be continuously plugged into an "A/C" source.

General Motors Upfitter Integration

http://www.gmupfitter.com • 1-800-875-4742 (Upfitter Hotline)

Bulletin #117

July 16, 2014



UI Bulletin #117

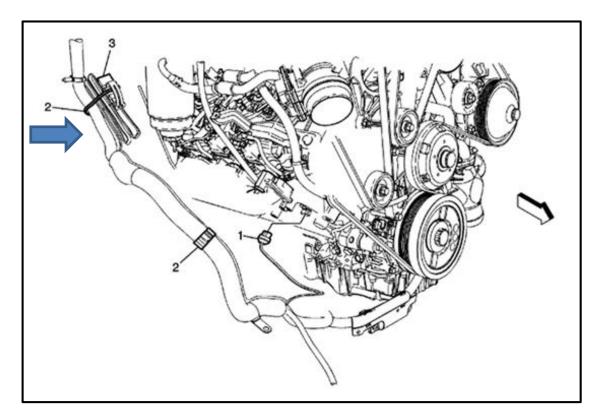


Figure 1

General Motors Upfitter Integration http://www.gmupfitter.com • 1-800-875-4742 (Upfitter Hotline)

Bulletin #117

July 16, 2014

Disclaimer: GM Upfitter Integration Technical Bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service and/or modification of a vehicle. These properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. Contact GM Upfitter Integration for information on whether the information is applicable your vehicle.