


MULTI-MODEL (EQUIPPED WITH MAZDA CONNECT) DTC U0323/U0423/U3000 CANNOT BE DELETED

Some vehicles (with MAZDA CONNECT) may exhibit a condition where DTC U0323(PCM) / U0423(ABS) /U3000(IC) CANNOT be deleted when the TPMS warning light flashes and/or the TCS/DSC indicator lights are illuminated. This can happen if the ignition is turned OFF within 20 seconds after the ignition is turned ON in one of the following two situations.

1. The "ROOM" fuse (Engine compartment) is NOT installed when battery level is low.
2. The CMU (Connectivity Master Unit) is NOT connected.

Repair Procedure

1. Verify if the CMU and the "ROOM" fuse are installed properly.
2. Change either the Temperature or the Distance setting in MAZDA CONNECT System Settings, then turn the ignition OFF.

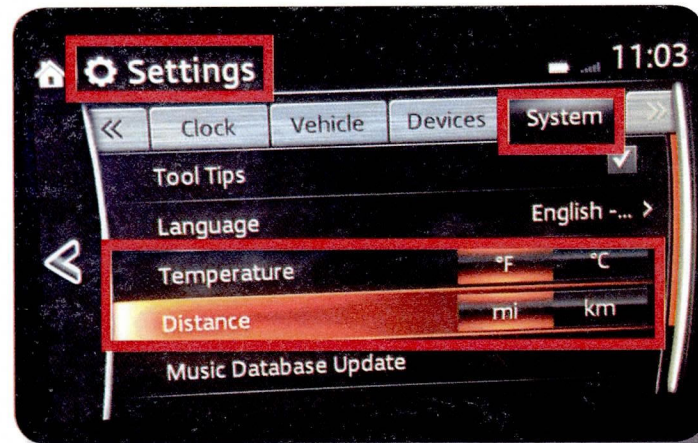

3. Turn the ignition ON and delete the DTC using M-MDS.
4. Return the original unit of Temperature or Distance in MAZDA CONNECT System Settings.

An editorial board comprised of MNAO service staff members generates, collects, and verifies information for this publication. © 2015 Mazda Motor of America, Inc.

To contribute repair tip ideas, send an e-mail to mtips@mazdausa.com or fax to (949) 442-6599. If we select your repair tip, you will receive 10,000 Reward Performance by Mazda (RPM) points for your efforts. All contributions become property of MNAO, which assumes permission to publish them without further consideration.