

45804	Some 2015-2016 F-150 and 2015 Edge vehicles with a 4" display may exhibit a 24 hour clock display that resets itself to a 12 hour display after cycling the ignition key. To correct the concern, reflash the Front Control Display Interface Module (FCDIM) to the latest calibration using IDS version 100.02 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at www.motorcraftservice.com . Use causal component 10D885 and applicable 12652A labor operations from Section 10 of the SLTS manual for reflash only.
-------	--