SSM 45857 Some 2015-2016 Edge and 2016 Lincoln MKX vehicles built on or before 3/23/2016 may exhibit overly sensitive brake applications. This will typically occur at low speed and/or in cold/wet conditions. To correct the condition, install an updated brake booster with part number F2GZ-2005-F (only 2.0L GTDI with 17→ rotors)or F2GZ-2005-E (all except 2.0L GTDI with 17→ rotors). Refer to Workshop Manual, Section 206-07. For claiming, use causal part 2005 and applicable labor operation(s) in the Service Labor Time Standard (SLTS) Section 2.