

Vibration in Front Seats, Floor, and Accelerator Pedal at Highway Speeds

AFFECTED VEHICLES

2015–16 TLX V6 with AWD

EDITOR’S NOTE: This article replaces the one posted in **July 2016** to extend the article’s shelf life. The issue(s) covered are still being addressed.

Are you feeling a vertical vibration in the front seats, the floor, and the accelerator pedal that starts as early as **50 mph**, progressively gets worse as speed increases, then peaks around **70 to 75 mph**?

To cut down on this vibration, replace the tires with this **new** part number:

Description	Tire Size	Part Number
Goodyear Eagle LS-2	225/50R18 95H	42751-GYR-051

This tire is available through our Tire Rack program and is now the **new** original equipment spec tire.

If tire replacement reduces the vibration, you’re done. But if that vibration is unchanged or it stays at an unacceptable level after replacement, then continue with normal troubleshooting.