

Reference	SSM71800
Models	Range Rover Evoque / L538
Title	P0196 Oil temperature sensor.
Category	Engine
Last modified	22-Apr-2014 00:00:00
Symptom	401000 Oil System Concerns
Content	<p><u>Issue:</u> On a small number of 14 MY L538 (Evoque) vehicles equipped with 2.0GTDi petrol engine, the EML warning light may illuminate due to the presence of fault P0196.</p> <p><u>Cause:</u> It may not be a failure of the Oil Temperature Sensor and could be the PCM software. Software levels lower than the ones listed below may cause this DTC to false flag.</p> <p><b>EJ32-12A650-MAK EJ32-12A650-MBK EJ32-12A650-MCK EJ32-12A650-MEK EJ32-12A650-MKK</b></p> <p><u>Action:</u></p> <ol style="list-style-type: none"> <li>1. Check the software level of the PCM.</li> <li>2. Update software if it is lower than the levels listed above. Once software is updated please ensure full diagnosis is still carried out to check for secondary faults with wiring, hardware etc.</li> <li>3. If the software was already at the specified level then this is not a false flag and the vehicle must be fully diagnosed and fixed as per usual procedure.</li> </ol>