

Reference	SSM71847
Models	Range Rover Evoque / L538
Title	9 speed automatic transmission faults
Category	Driveline
Last modified	05-Aug-2014 00:00:00
Symptom	501000 Automatic Transmission Concerns
Content	<p><u>Issue:</u> A small volume of 14 MY Evoque (L538) are flagging the following TCM DTC codes P07D4-07 or P2704-07 or P07E7-07 during SDD DTC read (which are all related to 9HP48 automatic transmission).</p> <p>.</p> <p><u>Cause:</u> Internal transmission diagnostics have been triggered. Further investigation is required by JLR.</p> <p><u>Action:</u> Check the transmission serial number (TSN) This is visible without component removal.</p> <ul style="list-style-type: none">• If DTC P07D4-07 and/or P2704-07 are stored and the TSN is <u>below</u> 63584, replace the transmission.• If DTC P07D4-07 and/or P2704-07 are stored and the TSN is 63584 or above, repair as per Topix instructions.• If DTC P07E7-07 is stored and the TSN is <u>below</u> 81206, replace the transmission.• If DTC P07E7-07 is stored and the TSN is 81206 or above please check the software level of the transmission control module. If the software level is earlier than the ones listed below, update the software. If the software is at or above this level, replace the transmission. <p>*In all cases whereby a replacement transmission is needed, please submit an EPQR detailing the symptoms, the fault and any diagnosis performed.</p> <p>**Seek FRED approval when ordering replacement transmissions unless specifically exempt.</p> <p>SOFTWARE LEVEL:</p> <p>EJ32-14C337-CAL (GTDI AD) EJ32-14C337-CBL (DW12C AD) EJ32-14C337-CCH (GTDI SD) EJ32-14C337-CDH (DW12C SD)</p>