

Reference	SSM72476
Models	Range Rover / L405 Range Rover Sport / L494
Title	16MY Td6 - During PDI, P068A-00 Is Observed In PCM
Category	Driveability
Last modified	29-Oct-2015 00:00:00
Symptom	698298 Malfunction Indicator Lamp

Content

Issue:
Engine Malfunction Indicator Lamp is illuminated at PDI with DTC P068A-00 stored in the PCM (Powertrain Control Module).
NOTE - affects 3.0 Td6 only.

Cause:
The transit relay is fitted prior to the PCM performing a full shutdown. This can result in a false flag of DTC P068A-00.

Action:
As part of PDI process use SDD to clear all DTC's. If this DTC P068A-00 does not return, no further action is required. If the code does return, please follow the actions recommended within the workshop manual section of TOPlx.