Service Bulletin

14-030

May 1, 2015 51969-01908 Version 6

Recall: Front Passenger's Airbag Inflator May Produce Excessive Pressure After Long-Term Exposure To High Absolute Humidity

Supersedes 14-030, dated December 11, 2014, to revise the information highlighted in yellow

AFFECTED VEHICLES

Year	Model	Trim	VIN Range
2003–05	MDX	ALL	Check the iN VIN status for eligibility
2005	RL	ALL	Check the iN VIN status for eligibility

REVISION SUMMARY

A label that has the part number and serial number of the inflator may be included in each airbag inflator kit to make tracking this information easier.

BACKGROUND

Certain Acura vehicles operated in areas known for high absolute humidity and high heat may contain a front passenger's airbag that, over time, may be affected by exposure to the humidity, which could produce excessive internal pressure upon deployment. If an affected airbag deploys, the increased internal pressure may cause the inflator casing to rupture. Metal fragments could be propelled upward toward the windshield, or downward toward the front passenger's foot well, possibly causing an injury to vehicle occupants.

Affected vehicles were sold and/or registered in California.

NOTE: If the VIN status inquiry indicates that the vehicle is subject to any open safety recalls, including the driver's airbag inflator, make sure to also complete those recall repairs before returning the vehicle to the client. If you are unable to complete any open recall, advise the client of the recall status and when the recall could be completed.

Vehicles sold and/or registered in Alabama, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, Guam, Saipan, American Samoa, and the U.S. Virgin Islands were superseded to Service Bulletin 14-044, Safety Recall: Front Passenger's Airbag Inflator May Produce Excessive Pressure After Long-Term Exposure To High Absolute Humidity.

CLIENT NOTIFICATION

Owners of affected vehicles will be sent a notification of this campaign.

Do an iN VIN status inquiry to make sure the vehicle is shown as eligible.

Some vehicles affected by this campaign may be in your used vehicle inventory. These vehicles must be repaired before they are sold.

Should your dealership sell an unrepaired vehicle that subsequently causes injury or damage because of the recalled item, the dealership will be solely responsible to the damaged party, and will be required to defend and indemnify American Honda for any resulting claims. To see if a vehicle in inventory is affected by this recall, do a VIN status inquiry before selling it.

CORRECTIVE ACTION

Replace the passenger's airbag inflator, then return the original, undeployed inflator as directed.

CLIENT INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Acura automobile dealer.

PARTS INFORMATION

Part Name	Part Number	Quantity
2003–05 MDX Front Passenger's Airbag Inflator Kit	04785-S3V-306	1
2005 RL Front Passenger's Airbag Inflator Kit	04785-SJA-306	1

NOTE:

- The inflator kit box must be used to return the recalled inflator to its supplier, ideally within 48 hours of the repair. Be careful not to damage the inflator kit box.
- If the recalled, undeployed inflator is not returned, the warranty claim for that vehicle will be charged back to your dealership.
- Follow the shipping instructions supplied with the inflator kit. If you have any questions about shipping, call Warranty Parts Inspection (WPI) at 937-642-2737.

WARRANTY CLAIM INFORMATION

NOTE:

- Process claims as quickly as possible so that resources can be properly allocated.
- Enter the part number of the inflator that you received into the warranty claim, not the part number that you ordered. For more information, refer to step 1 of REPAIR PROCEDURE.
- To avoid non-payment of warranty claims, the serial number of the new airbag inflator must be entered in the Diagnostic Trouble Codes field on each warranty claim. For more information, refer to step 1 of REPAIR PROCEDURE.
- To avoid a warranty claim being charged back to your dealership, you must return the original, undeployed inflator to its supplier. Follow the shipping instructions supplied with the inflator kit. If you have any questions about shipping, call Warranty Parts Inspection (WPI) at 937-642-2737.
- If you are a dealer in Alaska, Hawaii, Puerto Rico, Guam, Saipan, American Samoa, or the U.S. Virgin Islands call the WPI administrative office at **937-642-2737** for special instructions; do not use the documentation included in the airbag inflator kit.

Year/Model	Operation Number	Description	Flat Rate Time	Defect Code	Symptom Code	Template ID	Failed Part Number
2003-05 MDX	7541A7	Replace the	0.7 hr	5NX00	JJ300	14-030N	06780-S3V-A10ZA
2005 RL	7541A7	front passenger's airbag inflator.	0.8 hr	5NX00	JJ400	14-030P	06780-SJA-A80

Skill Level: Repair Technician


REPAIR PROCEDURE

NOTE:

- If the VIN status inquiry indicates that the vehicle is subject to any open safety recalls, including the driver's airbag inflator, make sure to also complete those recall repairs before returning the vehicle to the client. If you are unable to complete any open recall, advise the client of the recall status and when the recall could be completed.
- Be careful not to damage any parts when replacing the inflator, and follow the procedure exactly.
- If, before removing the airbag, you suspect that it may be the incorrect airbag for the vehicle or a counterfeit, **do not remove the airbag**. Contact your DPSM for assistance.
- 1. Peel the label located inside the inflator box from its backing and attach it to the R.O. For the warranty claim to be paid, the **replacement inflator part number that you received** must be on the warranty claim and your warranty clerk must enter the serial number in the Diagnostic Trouble Codes field.

NOTE:

- The replacement part number is printed on the top part of the label and the serial number is printed on the bottom. Make sure you attach the label to the R.O. and give it to the warranty clerk.
- There may also be a colored sticker located in the kit, ignore it because it is not used.
- Not all inflator kits have a label included. In those cases, write the serial number and part number from the side
 of the inflator box on the R.O. The part number always starts with 047.

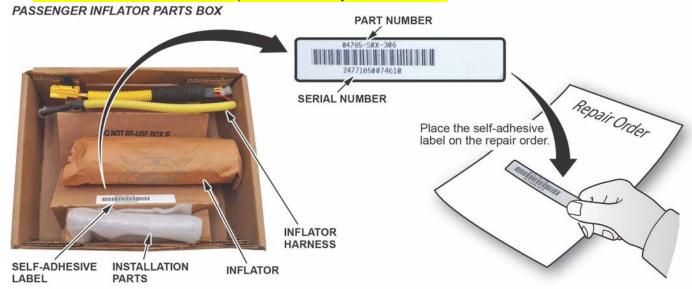

- 2. Remove the front passenger's airbag.
- 3. Place the airbag face-down on a clean shop towel as shown.


NOTE:

- The orientation of the airbag is critical because if the inflator is installed incorrectly, the harness will be too short when you reinstall the airbag.
- The brackets between the various models are similar but may differ from the example shown.



- 4. Visually inspect the airbag and the inflator for any unusual writing or markings.
 - If there is nothing unusual about the airbag or the inflator, go to step 5.
 - If there are any unusual markings, like an incorrect label or a model year written in marker, the airbag and inflator may not be the correct airbag and/or inflator for the vehicle or it may be a counterfeit part. For more information about counterfeit airbags, you can refer to safercar.gov, enter keywords MANAGING COUNTERFEIT, and select Recommended Dealer Guidance for Managing Counterfeit Air Bags from the list. If you suspect that the airbag or inflator is counterfeit, do not continue this procedure. Contact your DPSM for assistance.

NON-STANDARD SAFETY LABEL

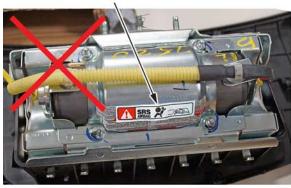




HAND ENGRAVING



5. Remove the harness from both ends of the inflator bracket.

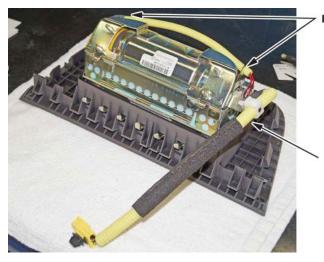

INFLATOR BRACKETS

Disconnect and remove the harness clip if applicable.


6. Short the red wires.

NOTE: You must cut and short the wires as indicated to prevent accidental deployment.

Cut the red wires as shown.




• Cut about 2 inches of the corrugated tube, then pull out the two red wires.

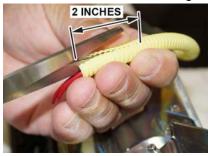




• Strip away about 1 inch of the wire insulation, then twist the wires together.



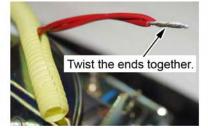

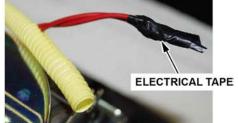

• Tape the twisted ends with electrical tape.


7. Cut off the connector and short the yellow wires.


You must cut and short the wires as indicated to prevent accidental deployment.

Cut all four wires to remove the connector.




• Cut about 2 inches of the corrugated tube, then pull out the yellow wires.

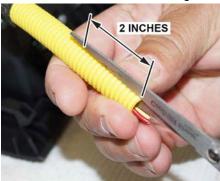


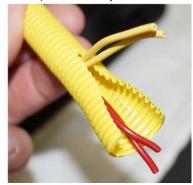


• Strip away about an inch of the wire insulation, then twist the wires together.



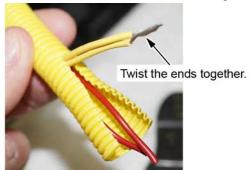

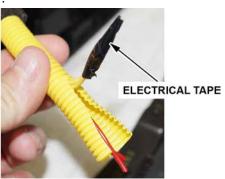

- Tape the twisted ends with electrical tape.
- 8. Remove the four inflator nuts.

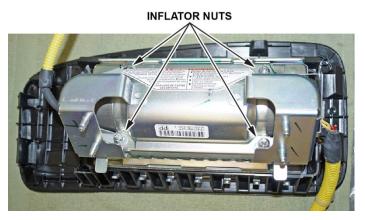

9. Remove the inflator bracket.

NOTE: You can only remove one of the brackets, as the other is welded to the airbag housing.




10. Remove the inflator by pushing it out.




- 11. Install the new inflator.
 - One connector looks like a "D" whereas the other connector is a circle. Make sure you insert the "D" connector into the airbag first.

NOTE: There is a yellow band marking on the circle side.

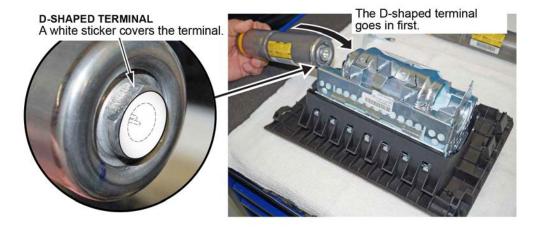

Slide the inflator in until the "D" aligns with the tab on the inflator bracket. There should be no space or gap between the inflator and bracket.




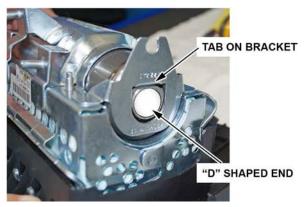

Reinstall the inflator bracket. There should be no space or gap between the bracket and inflator.



Install the new 5 mm locknuts and torque them in sequence to 3.9 Nom (34 lb-in).

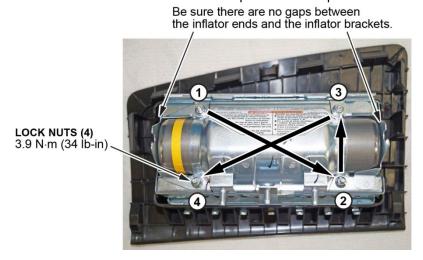


12. Remove the stickers covering the terminals on both sides of the new inflator.



- 13. Install the new inflator harness.
 - Make sure the airbag and harness are aligned as shown.
 NOTE: Make sure you have the orientation correct as shown below. If you connect the harness incorrectly, the harness cannot be removed, and you will not be able to reinstall the airbag because the harness will be too short.




• Connect the two connectors. Align the "T" shape in the inflator harness connector with the T-shaped inflator connector, then press the connector into place.

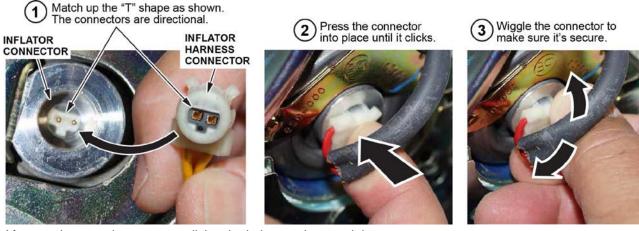

• After you hear each connector click, wiggle it to make sure it is secure. NOTE: If the connector is not properly aligned, it will come out.

- 14. Connect the harness to the inflator brackets.
 - Insert the side without the shrink-wrap tubing first. Insert the harness at the third "valley" in the corrugated tube.
 - Insert the side of the harness with the shrink-wrap tubing into the inflator bracket. Make sure the harness is securely inserted and that it does not sag.

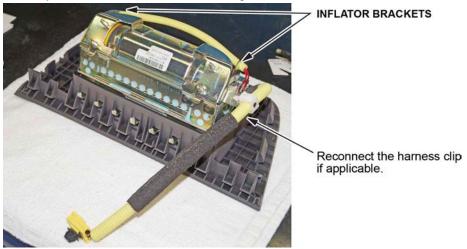

- 15. Reinstall the passenger's airbag into the vehicle and torque the new locknuts to 9.8 N•m (7.2 lb-ft).
- 16. Put the original inflator into the box the new one came in. Make sure there is no other hardware in the box because if the package rattles, it will not be accepted by the courier.
- 17. Follow the shipping instructions supplied with the inflator kit to return the undeployed inflator. If you have any questions about shipping, call Warranty Parts Inspection (WPI) at **937-642-2737**.
- 18. Give your warranty clerk the R.O. that includes the inflator serial number and replacement part number. For the warranty claim to be paid, the **replacement inflator part number** must be on the warranty claim and your warranty clerk must enter the serial number in the Diagnostic Trouble Codes field.

END