

**3.5L GASOLINE TURBOCHARGED DIRECT INJECTION (GTDI) -  
ILLUMINATED MIL WITH DTC P130D - BUILT ON OR BEFORE 13-  
SEP-2016**

**TSB 16-0126**

**FORD:**

2016-2017 Transit

**ISSUE**

Some 2016-2017 Transit vehicles equipped with a 3.5L GTDI engine and built on or before 13-Sep-2016 may exhibit an illuminated malfunction indicator lamp (MIL) with diagnostic trouble code (DTC) P130D and no related performance concern. An occasional spark knock noise may be noticed with this condition.

**ACTION**

Follow the Service Procedure steps to correct the condition.

**SERVICE PROCEDURE**

1. Connect the Ford Integrated Diagnostic System (IDS) service tool or equivalent scan tool to the data link connector (DLC). Does the vehicle exhibit an illuminated MIL with DTC P130D stored in the powertrain control module (PCM) memory?
  - a. Yes - proceed to Step 2.
  - b. No - this article does not apply. Refer to the Powertrain Control/Emissions Diagnosis (PC/ED) manual for normal diagnostics
2. Reprogram the powertrain control module (PCM) to the latest calibration using IDS release 102.02 or higher. Make sure you are connected to the internet when entering module programming to obtain the latest updates. Calibration files may also be obtained at [www.motorcraftservice.com](http://www.motorcraftservice.com).

NOTE: ADVISE THE CUSTOMER THAT THIS VEHICLE IS EQUIPPED WITH AN ADAPTIVE TRANSMISSION SHIFT STRATEGY WHICH ALLOWS THE VEHICLE'S COMPUTER TO LEARN THE TRANSMISSION'S UNIQUE PARAMETERS AND IMPROVE SHIFT QUALITY. WHEN THE ADAPTIVE STRATEGY IS RESET, THE COMPUTER WILL BEGIN A RE-LEARNING PROCESS. THIS RE-LEARNING PROCESS MAY RESULT IN FIRMER THAN NORMAL UPSHIFTS AND DOWNSHIFTS FOR SEVERAL DAYS.

OPERATION	DESCRIPTION	TIME
160126A	2016-2017 Transit 3.5L GTDI: Retrieve DTCs And Reprogram The PCM (Do Not Use With Any Other Labor Operations)	0.3 Hr.

**WARRANTY STATUS:**

Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage  
Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

**DEALER CODING**

BASIC PART NO.	CONDITION CODE
RECALEM	04

NOTE: The information contained in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.