

## View Message

---

**Sent on** 01 13 2015 **Expires on** 01 27 2015  
**From** Parts and Service Division  
**Subject** Cross-Traffic Monitoring System-No Audio Alert (PUD #14-054) Revised Procedure

Message **PRIORITY/ACTION REQUIRED**

**To:** All Acura Service Managers  
**From:** Parts and Service  
**Re:** Cross-Traffic Monitoring System – No Audible Alert Product Update  
(PUD #14-054) Revised Procedure

Print this iN message and give a copy to the Shop Foreman, all Service Consultants, all Technicians, and appropriate personnel.

Dear Service Manager,

This issue applies to the **TLX with V6 ONLY**.

The METER reflash process for Cross Traffic Monitoring System inadvertently erases the idle characteristics learned by the PCM, and the HDS shows Idle Torque Learning as "Not Completed." The drivability symptoms which can result from this condition range from harsh 2-1 downshift, high rpm at idle, surging coming to a stop, and idle fluctuation.

Once the reflash process is complete and all the DTC's are cleared, reset the PCM using the HDS and follow the "Idle Learn Procedure" in the service manual. These additional steps take 0.2hrs to complete and needs to be added to the flat rate of 0.5hrs on the V6 models only.

The PUD is being revised to reflect this new direction and will be published soon.

Thank you

[▲ BACK TO TOP](#)

© 2000–2015, American Honda Motor Co., Inc. All Rights Reserved.