


Subject: 2009-2013 MAZDA6 - WINDSHIELD WIPERS INOPERATIVE AT TIMES DUE TO MISSING WIPER MOTOR COVER	M-Tips No.: MT-011/17
	Last Issued: 06/08/2017

DESCRIPTION

APPLICABLE MODEL(S)/VINS

2009-2013 Mazda6

Some vehicles may experience intermittent non-operation of the windshield wipers. The wiper motor cover (A) may have been discarded during a previous repair. The missing wiper motor cover (A) may allow elements to contaminate the wiper motor (B) and cause an intermittent open circuit.

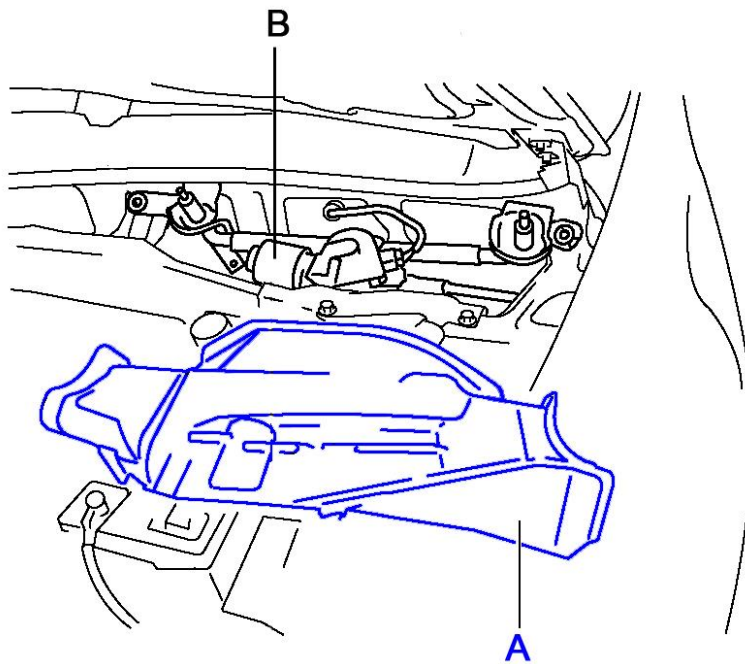

REPAIR PROCEDURE

If the diagnosis requires a wiper motor replacement to correct the customers concern, install the wiper motor cover if it is missing.

NOTE: Installation of a new wiper motor with a missing wiper motor cover may create a customer come-back situation.

PARTS INFORMATION

NOTE: Wiper cover is not listed in GEPC WINDSHIELD WIPERS section. It is listed with the GEPC COWL & EXTRACTOR GRILLES section.

WARRANTY INFORMATION

Warranty Compliance Note:

Replacement of missing wiper cover or damaged wiper motor due to missing wiper cover is not covered under Mazda's warranty policy.