
ATTENTION:

GENERAL MANAGER PARTS MANAGER CLAIMS PERSONNEL SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.

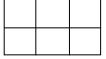

© 2016 Subaru of America, Inc. All rights reserved.



SERVICE BULLETIN

APPLICABILITY: 2015-2017MY Legacy and Outback

NUMBER: 09-66-16

DATE: 12/29/16

SUBJECT: Rear Muffler Shell Rigidity Enhancement

INTRODUCTION:

This bulletin announces a change in the production procedure for the rear muffler assembly. Spot-weld locations securing the outer shell portion have been changed to improve overall rigidity. A gap may develop at the spot welded seam as a result of repeated thermal shock (heating / cooling) which occurs during normal use. The gap does **not** create an exhaust leak. In some cases, a rattling sound from the muffler may develop.


PRODUCTION CHANGE INFORMATION:

The new mufflers were incorporated into production during early November, 2016 per the table below:

Vehicle / Model	Engine	Starting VIN		
Legacy	2.5L	H*039596		
	3.6L	H*039797		
Outback	2.5L	H*297010		
	3.6L	H*297013		

PART INFORMATION:

The line of spot-welds has been repositioned approximately 2" (50 mm) as shown below.

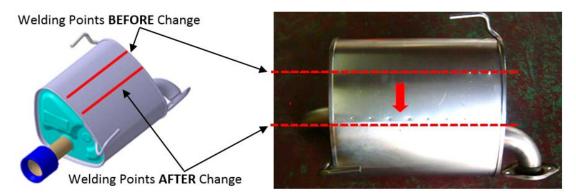

Continued...

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

SUBARU OF AMERICA, INC. IS ISO 14001 COMPLIANT

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

NOTE: This table is provided for reference only. Always confirm with your Parts Department to insure all needed parts with the most up-to-date part numbers are ordered.

Description	Part Number	Applicability	
MUFFLER ASSY	44300AL00B	2.5L OUTBACK	
MUFFLER ASSY LH	44300AL01B	3.6L OUTBACK	
MUFFLER ASSY RH	44300AL02B		
MUFFLER ASSY	44300AL03B	2.5L LEGACY*	
WUFFLEN ASST	44300AL04B	2.5L LEGACY**	
MUFFLER ASSY LH	44300AL05B	3.6L LEGACY	
MUFFLER ASSY RH	44300AL06B		

^{*} w/out Cutter (Chrome tail pipe cover)

** w/ Cutter

SERVICE PROCEDURE / INFORMATION:

When muffler replacement is required, follow the service procedure in the applicable Service Manual.

WARRANTY / CLAIM INFORMATION:

For vehicles within the Basic New Car Limited Warranty period, this repair may be submitted using the following claim information:

Labor Description	Labor Operation #	Labor Time	Fail Code
EXHAUST GASKET AND / OR MUFFLER R&R	B229-281	0.2	
EXHAUST GASKET AND / OR MUFFLERS R&R- (BOTH) H6 MODELS	B229-284	0.3	EAE-25
EXHAUST SYSTEM NOUISE / LEAK TESTING	C229-001	0.2	

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.