

Reference	SSM73143
Models	Discovery / L462 Range Rover / L405 Range Rover Sport / L494
Title	Fuel Level Display Low or Zero When Full - 17my
Category	Electrical
Last modified	30-Jan-2017 00:00:00
Symptom	206000 Warning Indicators
Content	<p>Issue: A customer may report that the fuel level display's low when the actual quantity of fuel in the tank is higher or possibly full. The Diagnostic Trouble Codes (DTCs) B1A75-11 Fuel Sender 1 and B1A76-11 Fuel Sender 2 will be present in the Body Control Module (BCM) if the concern appears. If the vehicle ignition is switched off for a period of time up to 2 minutes and then back on again, the fuel gauge reading will return to normal.</p> <p>Cause: Body Control Module Software</p> <p>Action: If a customer reports the concern and the DTCs are present in the BCM using Pathfinder version 44 loaded, download the latest software to the BCM.</p> <p>Affected VIN range – 17MY Range Rover 12403 to 138521, 17MY Range Rover Sport 320324 to 333477 and 666892 to 673461, 17MY New Discovery 00053 to 002440.</p> <p>Technicians - Please rate this SSM and provide comments so that future communications can be improved.</p> <p>1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.</p> <p>3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.</p> <p>5 = Excellent – All required information provided to resolve the customer concern.</p>