

Reference	SSM73402
Models	Discovery / L462 Range Rover / L405 Range Rover Sport / L494
Title	L494, L405 & L462 Fuel Level Display Low Or Zero When Full: 17MY only
Category	Electrical
Last modified	12-Jun-2017 00:00:00
Symptom	205000 Electrical Accessories

Content

Issue: A customer may report that the fuel level displays low when the quantity of fuel in the tank is higher or possibly full. The Diagnostic Trouble Codes (DTCs) B1A75-11 Fuel Sender 1 and B1A76-11 Fuel Sender 2 will be present in the Body Control Module (BCM) if the concern appears. If the vehicle ignition is switched off for a period of time up to 2 minutes and then back on again, the fuel gauge reading will return to normal.

Cause: Body Control module Software

Action: If a customer reports the concern and the DTCs are present in the BCM using Pathfinder version 84 or later loaded, carry out the following procedure:

1. Check that the Gateway Module software is at the latest level, update if necessary.
2. Update the Body Control Module software to the latest level.

Affected VIN range –

17MY Range Rover 320324 to 333477

17MY Range Rover Sport 124031 to 138521 and 666892 to 673461,

17MY New Discovery 000532 to 002440.

Technicians - Please rate this SSM and provide comments so that future communications can be improved.

1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.