

Reference	SSM72326
Models	Discovery Sport / L550 LR2 / L359 Range Rover Evoque / L538
Title	L538 & L359 12MY Onwards 2.0 GTDi - Coolant leak from Radiator
Category	Engine
Last modified	07-Jun-2017 00:00:00
Symptom	402000 Cooling System Concerns
Attachments	11Fit Cable Tie.pdf (11Fit Cable Tie.pdf)

Content

Concern:
L359 and L538, 12MY onwards with 2.0GTDi engines, a warning indicator may illuminate on the IP (Instrument Pack) for low coolant level and coolant visible on the ground at the front area of the engine bay. On inspection, the coolant leak is from the radiator.

Cause:
Under investigation.

Interim Containment Action:
When the new radiator is fitted: -

- Do not install the 2 bolts that hold the Radiator and the Intercooler together
- Install 2 service cable ties (part number UKC6684L) in place of the bolts - see attached photo of the cable tie location

Permanent Corrective Action:
JLR are developing a permanent fix and will issue a new communication in Topix when validated. The current estimated release of the new information will be end of June 2017.

Technicians - Please rate this SSM and provide comments so that future communications can be improved.



1 = Poor – Basic information provided – The SSM does not help me resolve the customer concern.

3 = Average – Adequate information provided – The SSM partially helps me resolve the customer concern.

5 = Excellent – All required information provided to resolve the customer concern.



Do not install 不要安装

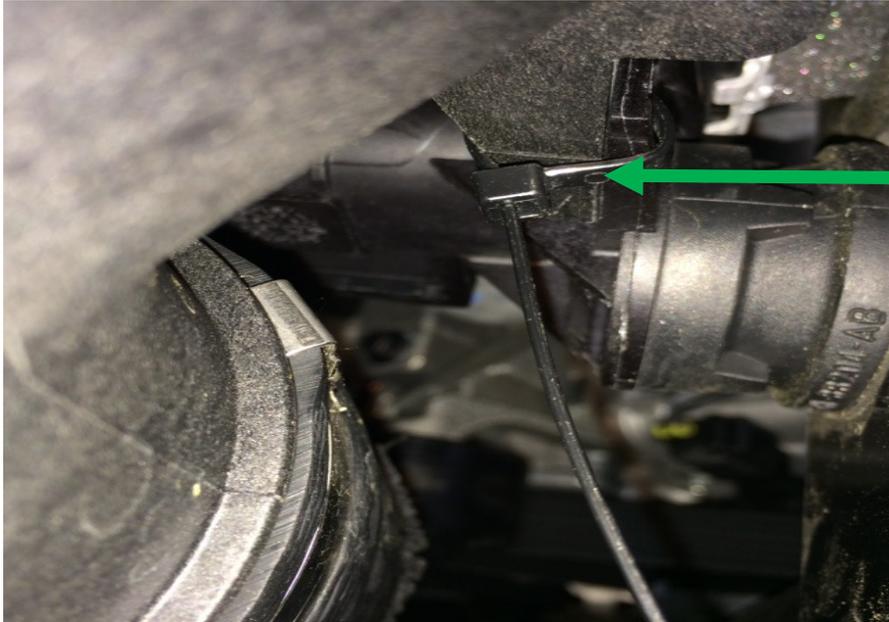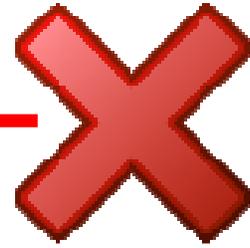

Fit 适合

