

TECHNICAL BULLETIN
LTB01022NAS1
04 NOV 2016



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-00

'Rattle' Noise From Glovebox Area / Loose BCM Cover

AFFECTED VEHICLE RANGE:

Discovery Sport (LC)

Model Year: 2015 Onwards
VIN: 501001 Onwards
Assembly Plant: Halewood

MARKETS:

NAS

CONDITION SUMMARY:

Situation: A 'rattle' noise may be evident from the glovebox area. Upon further inspection, checking the glovebox results in no fault found.

Cause: This may be caused by the Body Control Module (BCM) cover in the front passenger footwell which can become loose and generate unwanted noise.

Action: Should a Customer express this concern, follow the Service Instruction below.

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**


 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Panel - Closing - Renew	76.46.27	0.1	07	LR059777

 **NOTE: Normal Warranty procedures apply.**

SERVICE INSTRUCTION:

1. Open the front right door.
2. Remove the Body Control Module (BCM) cover from the passenger footwell.

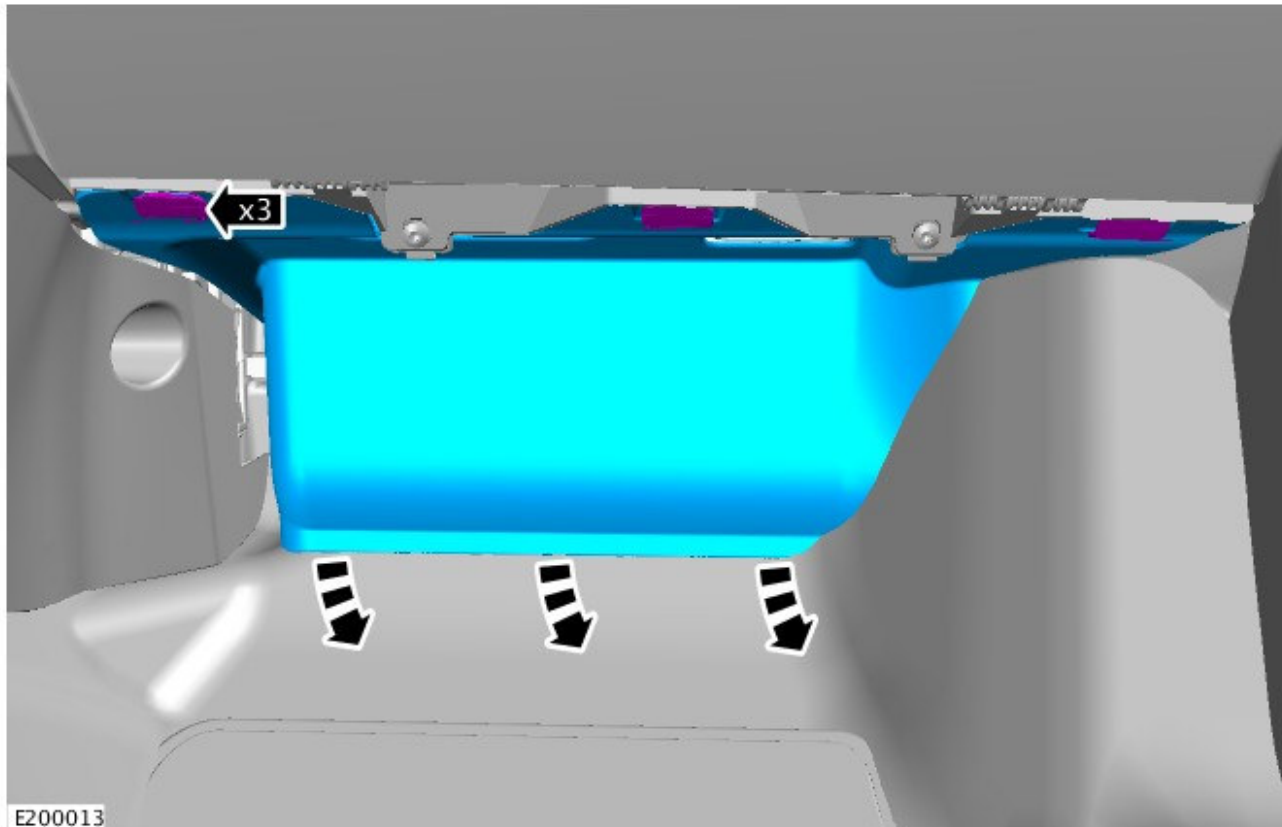

3. Visually inspect the position of the wiring harness as it may be positioned over the floor carpet as illustrated.

- If the wiring harness is not positioned over the floor carpet, go to Step 5.
- If the wiring harness is positioned over the floor carpet, go to Step 4.




E200016

4. Position the wiring harness behind the floor carpet as illustrated.




E200017

5. Install the BCM cover in the passenger footwell.

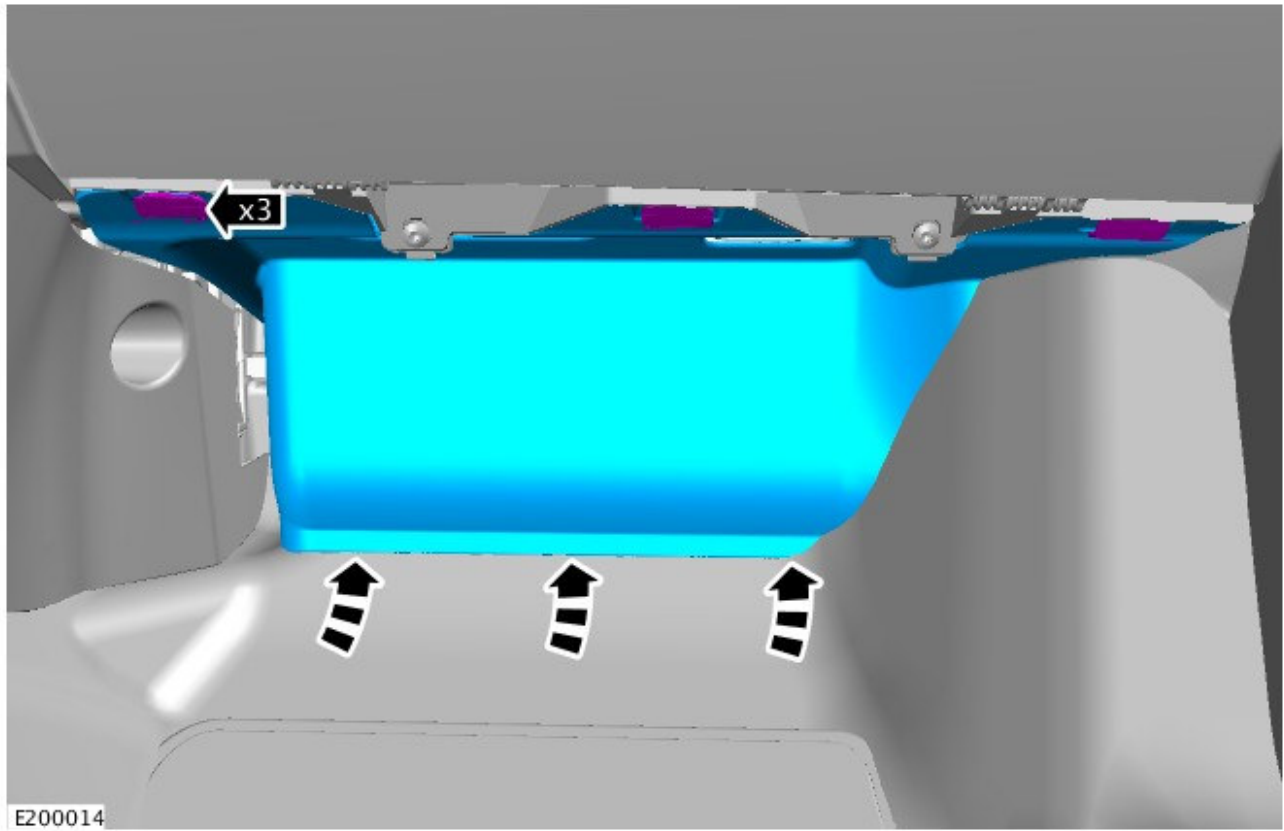

6. Visually check that there is no gap between the BCM cover and the floor carpet and that it is securely installed.

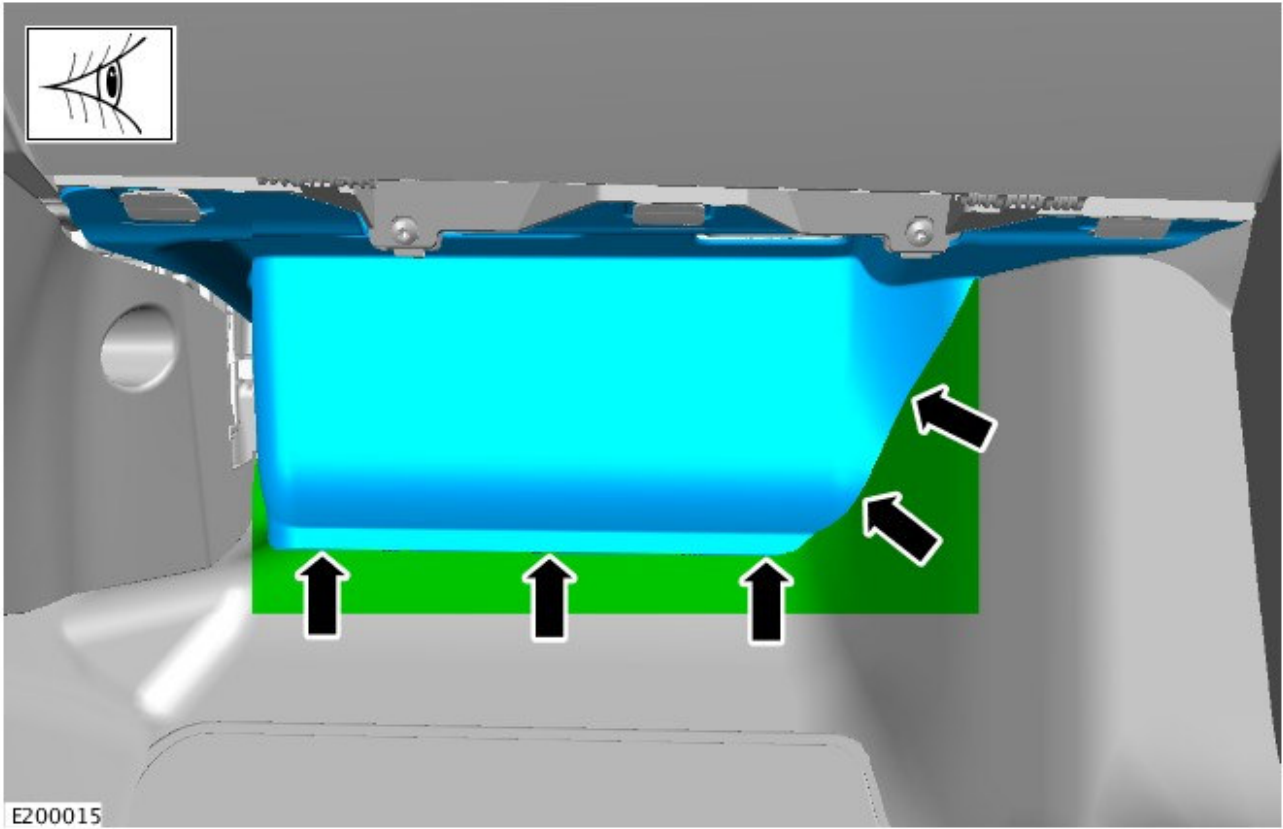

7. Close the front right door.