

LTB01005NAS2

TECHNICAL BULLETIN

03 FEB 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in blue

SECTION:

501-05

SUBJECT/CONCERN:Loadspace Cover Handle Assembly - Flap Fails to Return to Rest Position

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
Range Rover Sport (LW)	2014 Onwards	000001 Onwards	Solihull
Discovery Sport (LC)	2015 Onwards	501001 Onwards	Halewood

MARKETS:NAS

CONDITION SUMMARY:**SITUATION:**

The luggage compartment loadspace cover handle flap may be broken and fail to return to the rest position.

CAUSE:

This may be caused as the end pin of the flap is easily distorted when the flap is overloaded which may lead to the pin disengaging from the slot and the loss of the spring from the assembly.

ACTION:

Should a Customer express this concern, follow the Service Instruction below.

PARTS:

PART NUMBER	DESCRIPTION	QUANTITY:
LR095704	Handle Assembly - Loadspace Cover - Lunar	1

PART NUMBER	DESCRIPTION	QUANTITY:
LR095705	Handle Assembly - Loadspace Cover - Ebony	1
LR096519	Handle Assembly - Loadspace Cover - Espresso	1

WARRANTY:
NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.
- DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Loadspace cover - Handle assembly - Renew - Discovery Sport (L550)	76.19.89.35	0.1	01	LR073376
Loadspace cover - Handle assembly - Renew - Range Rover Sport (L494)	76.19.89.35	0.1	01	LR081726


NOTE:

Normal Warranty procedures apply.

SERVICE INSTRUCTION:

- 1 Open the tailgate.
-

2

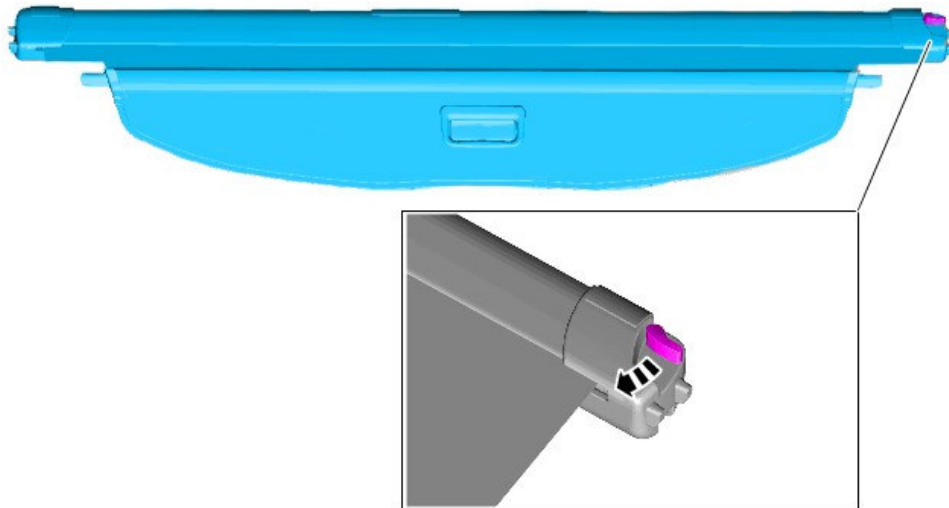

E197522

Remove the loadspace cover from the vehicle.

3


NOTE:

Make sure to place the loadspace cover on a clean and flat surface to avoid damage to the loadspace cover.

Place the loadspace cover upside down on a clean and flat surface (opposed to in-vehicle orientation).



Lift the flap on the loadspace cover handle to access the fasteners.

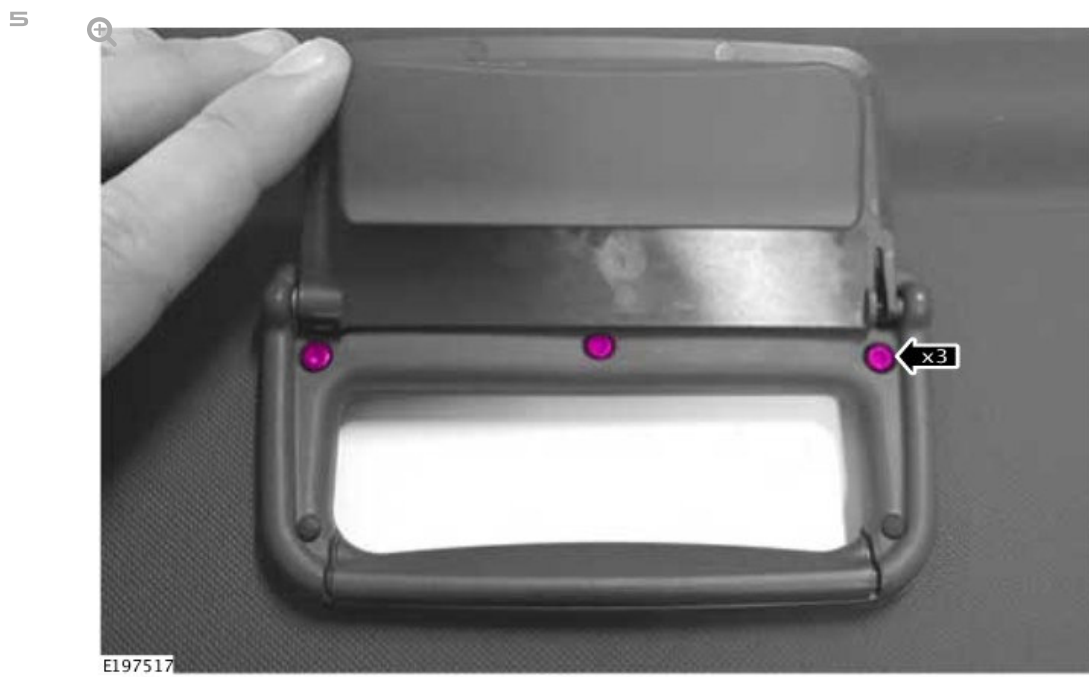


Remove the three fasteners.

6




Remove and discard the loadspace cover handle lower bezel.

7

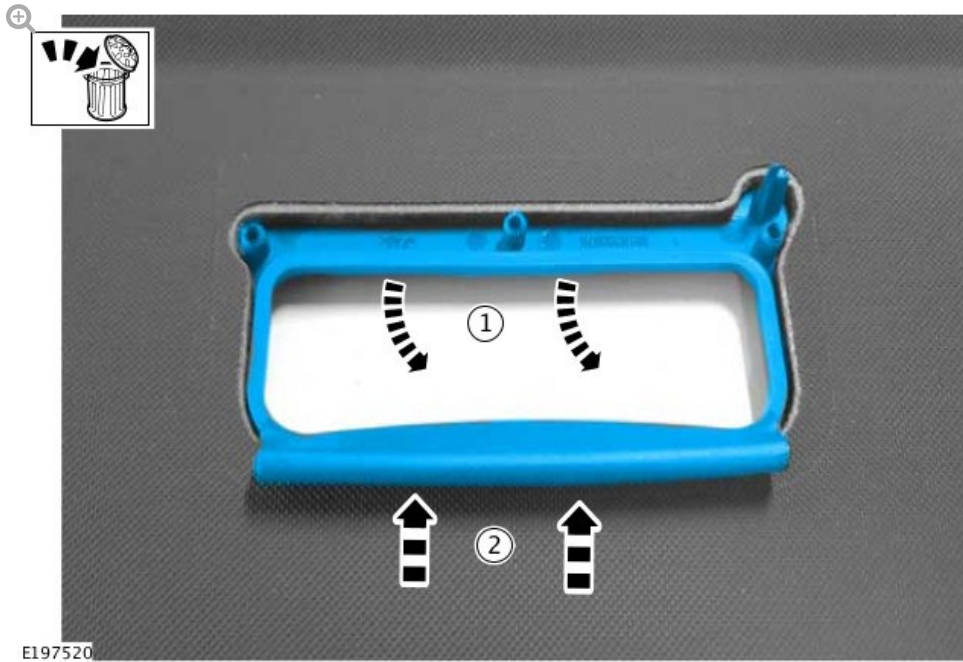

Remove and discard the loadspace cover handle upper bezel from below.

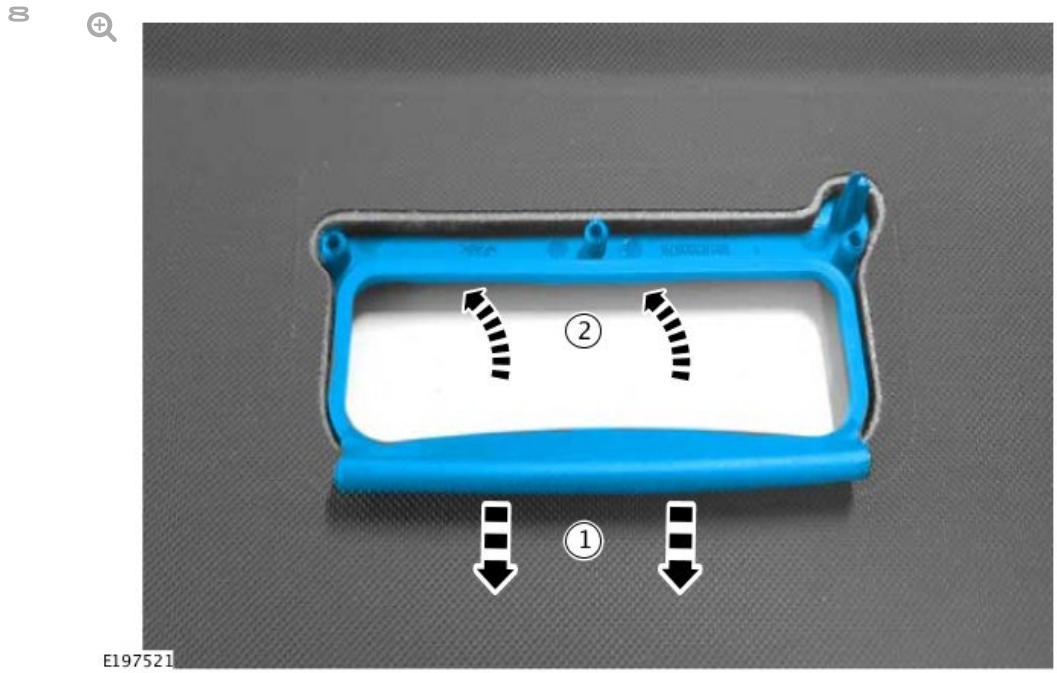

Install a new loadspace cover handle upper bezel from below.




Install a new loadspace cover handle lower bezel.

10



Lift the flap on the loadspace cover handle.

11

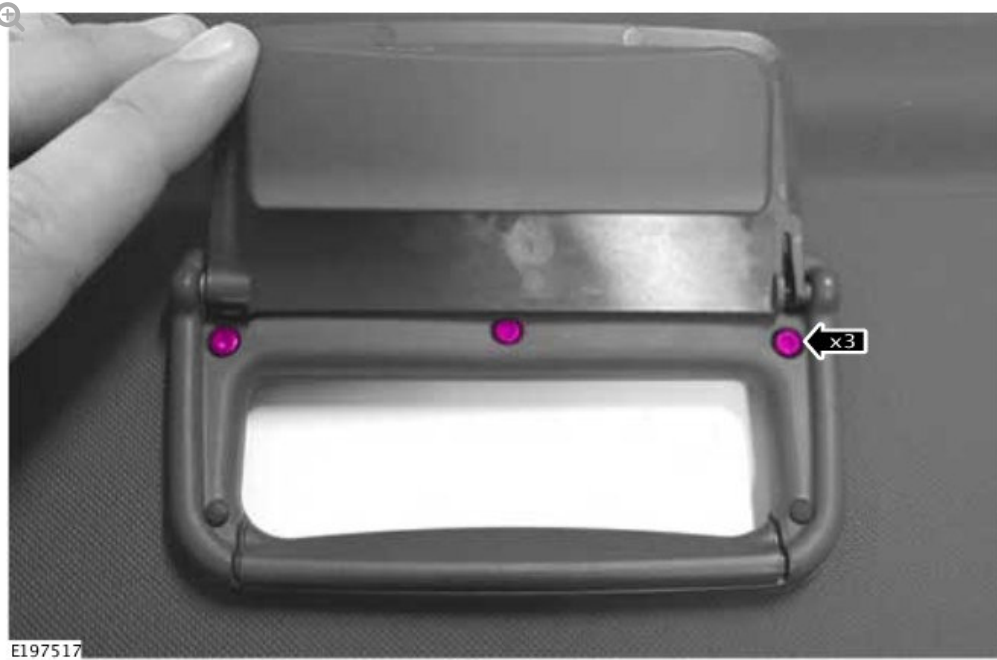

Install the three fasteners to attach the lower bezel to the upper bezel and release the flap.

- Torque: **0.5 Nm.**

12



E197523

Install the loadspace cover into the vehicle and check the handle operates correctly.

13 Close the tailgate.