



Group:	0-General
Bulletin No.:	SA-14-024
Issue Date:	10-7-2014

SERVICE ALERT

15MY CONVENTIONAL DTC P2080 AND P2084

Release Date: 10/7/2014

Affected Years: 2015 Model Year

Affected Models: Conventional Trucks

Attn: Service Managers / Service Personnel / Technical Service Managers

SUBJECT

The DTC's P2080 and P2084 and a MIL on, may be found on 15MY Conventional models. These diagnostic codes may be set due to a software detection anomaly that can occur under certain conditions. An ECU software update to address this condition has been released.

INSPECTION PROCEDURE

1. Check the vehicle DTC's and ensure there are no other codes present other than the P2080/2084 in the Engine ECU. If other codes are present, diagnostics should be performed as directed by the service manual.
2. If no other DTC's are present, clear the 2080/2084 codes and update the software to the following table.

PART NUMBER	DESCRIPTION	
89663-E3651 or above	15MY	J08EVC ECU Software
89663-E3661 or above	15MY	J08EVB ECU Software

Note: This service alert is provided as information and is not authorization for a warrantable repair. Please check the warranty policy manual or contact the warranty department for coverage details if applicable.

Sincerely,

Your HINO Service Team