

Classification:

Reference:

COPYRIGHT® NISSAN NORTH AMERICA, INC.

Date

EL15-041a ITB16-040a November 3, 2016

# 2013 JX35 AND 2014-2015 QX60; DOOR MIRROR WILL NOT RETURN TO SET POSITION AFTER SHIFTING FROM REVERSE TO DRIVE

This bulletin has been amended. The Title has been modified, and references to Automatic Drive Positioner have been changed to Seat Control Unit. No other changes have been made. Please discard all previous versions.

**APPLIED VEHICLES**: 2013 JX35 (L50) equipped with ADP

2014 - 2015 QX60 (L50) equipped with ADP

2014 - 2015 QX60 Hybrid (L50) equipped with ADP

**APPLIED VIN:** 2013 – 2014: All VINs

2015: Built before 5N1AL0M(\*\*)FC 525221

**APPLIED DATE:** Built before April 7, 2015


#### IF YOU CONFIRM

The door mirror (LH and RH) automatic tilt down-up feature does not return the mirror to original position after shifting from reverse to drive.

#### **ACTION**

Replace the Seat Control Unit.

- Use the <u>new</u> part listed in the Parts Information.
- For replacement information, refer to the appropriate Electronic Service Manual (ESM) Section J, Body Interior, ADP-Automatic Drive Positioner, DRIVER SEAT CONTROL UNIT, Removal and Installation.

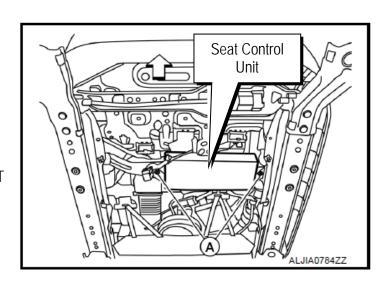

Infiniti Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Infiniti retailer to determine if this applies to your vehicle.

## PARTS INFORMATION

DESCRIPTION	PART NUMBER	QUANTITY
CONTROLLER ASSEMBLY-POWER SEAT	28565 – 3JA1A	1

### **CLAIMS INFORMATION**

Submit a Primary Part (PP) type claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
Replace Seat Control Unit	(1)	VH72AA	HD	32	(2)

- (1) Refer to the electronic parts catalog (FAST) and use the Power Seat Controller (28565-\*\*\*\*\*) as the Primary Failed Part.
- (2) Reference the current Infiniti Warranty Flat Rate Manual and use the indicated FRT.

2/10 ITB16-040a