

**Eliminating Symptoms in Body Interior: Replacing Engine-compartment Blower in Pairs (Warning message "Engine fan has failed" in the multi-function display/SY2916)**

**General information**

Model Line: 911 (991) Gen. II

Model Year: **As of 2017**

Symptom The yellow warning message "Engine fan failure, Avoid full engine load, Driving permitted" appears in the multi-function display.

Cause: Moisture seeping into the engine-compartment blower causes corrosion and the engine-compartment blower can fail as a result.

Date of Introduction: The optimized engine-compartment blower has been installed during production since May 20, 2016.

Parts Info: 991.624.052.03 – **NEW** – ⇒ Engine-compartment blower (Must be replaced in pairs: 2 ea.)  
 991.624.052.01 – Old ⇒ Engine-compartment blower

Remedial action: On vehicles equipped with the old engine-compartment blower (old version) **both** old engine-compartment blowers must be replaced once with the new version (Part No.: 991.624.052.03) in the event of a complaint. ⇒ *Workshop Manual '198119 Removing and installing engine-compartment blower'*

Invoicing: The work involved is invoiced under the labor operation:

APOS	Labor operation	I No.
19812010	Removing and installing engine-compartment blower	

For invoicing and documentation using PQIS, enter the following coding:

Location (FES5)	19810	Engine-compartment blower
Damage type (SA4)	1611	does not function

References: Removing and installing engine-compartment blower. ⇒ *Workshop Manual '198119 Removing and installing engine-compartment blower'*

**Important Notice:** Technical Bulletins issued by Porsche Cars North America, Inc. are intended only for use by professional automotive technicians who have attended Porsche service training courses. They are written to inform those technicians of conditions that may occur on some Porsche vehicles, or to provide information that could assist in the proper servicing of a vehicle. Porsche special tools may be necessary in order to perform certain operations identified in these bulletins. Use of tools and procedures other than those Porsche recommends in these bulletins may be detrimental to the safe operation of your vehicle, and may endanger the people working on it. Properly trained Porsche technicians have the equipment, tools, safety instructions, and know-how to do the job properly and safely. If a particular condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your authorized Porsche Dealer for the latest information about whether a particular technical bulletin applies to your vehicle. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify the current and correct part numbers. The work procedures updated electronically in the Porsche PIWIS diagnostic and testing device take precedence and, in the event of a discrepancy, the work procedures in the PIWIS Tester are the ones that must be followed.

© Porsche Cars North America, Inc.

Dealership	Service Manager	Shop Foreman	Service Technician
Distribution			
Routing	Asst. Manager	Warranty Admin.	Service Technician

Dr. Ing. h.c. F. Porsche AG is the owner of numerous trademarks, both registered and unregistered, including without limitation the Porsche Crest®, Porsche®, Boxster®, Carrera®, Cayenne®, Cayman®, Macan®, Panamera®, Speedster®, Spyder®, 918 Spyder®, Tiptronic®, VarioCam®, PCM®, PDK®, 911®, RS®, 4S®, FOUR, UNCOMPROMISED®, and the model numbers and the distinctive shapes of the Porsche automobiles such as, the federally registered 911 and Boxster automobiles. The third party trademarks contained herein are the properties of their respective owners. Porsche Cars North America, Inc. believes the specifications to be correct at the time of printing. Specifications, performance standards, standard equipment, options, and other elements shown are subject to change without notice. Some options may be unavailable when a car is built. Some vehicles may be shown with non-U.S. equipment. The information contained herein is for internal authorized Porsche dealer use only and cannot be copied or distributed. Porsche recommends seat belt usage and observance of traffic laws at all times.

Printed in the USA