



Tech Tips

TT 26-15-03

Date: March 27, 2015

2015 Touareg (3.0L TDI – CNRB) – MIL on - P20FE00 Fault

If during diagnosis for MIL on there is a P20FE00 fault present, follow the procedure below to prevent unnecessary replacement of parts.

Test Procedure:

- Verify the customer complaint of MIL on with P20FE00 present.
- Check reductant agent injector for correct part number (4H0131113A). If incorrect part is installed, install correct part.

If correct part is installed:

- Perform the guided function for the SCR metering quantity test.

If test fails:

- Replace parts as necessary.

If test passes:

- Clear faults and return vehicle to customer.