

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

VW Elsa Newsletter



Das Auto.

Edition 111: November 10, 2014

Content

- [MY11–MY13 Routan
TIPM Module
Replacement: Important
Installation Instructions](#)
- [Reminder:
Improvements to
Technical Information
Titles in ElsaPro](#)
- [Technical Bulletins](#)
- [Pending Service
Solutions](#)
- [Tech Tips](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



MY11–MY13 Routan TIPM Module Replacement: Important Installation Instructions

New TIPM part numbers released with modified software.

Model Year	New TIPM Repair Kits
2011	7B0998049B
2012	7B0998049
2013	7B0998049A

The TIPM module replacements for MY11–MY13 have a new software modification that requires the wiring to be modified for the turn signals.

Each kit will contain instructions on how to modify the wiring. You can also reference TT 2038940 for modification instructions.

[Back to top](#)

Reminder: Improvements to Technical Information Titles in ElsaPro

Today you will see changes to a couple links and folder names related to the Technical Service Handbook section of Elsa. These changes were made in response to technician feedback to help clarify where certain content can be found. Here is a quick list of the changes:

- On the home page of Elsa, the Systems menu link “Notes” is renamed **“Special Repair Information”**.
- The folder titled “Vehicle-specific service information” is retitled **“Special Repair Information”**.
- The “Technical Product Information” folder, which contains the Technical Bulletins, will be properly retitled **“Technical Service Bulletins”**.
- The “Service TPI” folder will be retitled **“Technical Product Information”**.

A complete document, with images can be found on **ServiceNet** under **Technician References/ElsaPro Job Aids/“Improvements to Technical Information Titles in ElsaPro”**.

[Back to top](#)

Technical Bulletins

15 14 04 - 2038672 MIL ON, DTCs P0300, P0302, P0304 or P0306 Stored in ECM Fault Memory

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Routan	2011–2012	3.6L (CJRA)	All	All	All

Customers may experience a Malfunction Indicator Lamp (MIL) illumination. Upon further investigation the Technician may find that any the following Diagnostic Trouble Codes have been set:

- P0300- Multiple Cylinder Misfire
 - P0302- Cylinder 2 Misfire
 - P0304- Cylinder 4 Misfire
 - P0306- Cylinder 6 Misfire

Tip:

- [wiTECH™ SOFTWARE LEVEL MUST BE AT RELEASE 13.04.7 OR HIGHER FOR THIS BULLETIN](#)
- [StarMOBILE™ SOFTWARE LEVEL MUST BE AT RELEASE 10.01 OR HIGHER FOR THIS BULLETIN](#) **Production Solution:** Cylinder Head improvement MY2013.

57 14 04 - 2038202 Supersedes Technical Bulletin V571403 dated September 19, 2014 to include model year 2015 applicability with VIN ranges and remove labor operation 571900 which is contained in labor operation 57171950.

Front Door Locks Hard to Release

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Jetta (A6)	2011–2014	All	All	All	All
Jetta (A6)	2015	All	All	AJ_FM200001	AJ_FM219981
Jetta (A6)	2015	All	All	AJ_FM350001	AJ_FM354021
Golf/GTI (A7)	2015	All	All	AU_FM000001	AU_FM032085
Beetle, Passat NMS	2012–2014	All	All	All	All
Beetle	2015	All	All	AT_FM600001	AT_FM619716

Beetle Convertible	2013–2014	All	All	All	All
Beetle Convertible	2015	All	All	AT_FM800001	AT_FM804950
Passat NMS	2015	All	All	A3_FC000001	A3_FC025559
Customer may comment that the front door is hard to open with exterior handle. Production Solution: Improved front door locks.					

Pending Service Solutions

No new Pending Service Solutions this week.

[Back to top](#)

Tech Tips

37-14-01 No Mechatronic Communication DTC 01315			
Model(s)	Year	Eng.Code	Trans.Code
Passat/CC, Eos, Beetle, GTI/Golf	2014–2015	All	All
For communication faults set in various modules indicating loss of, or no communication with the mechatronic, please inspect the barrel connector lock for proper installation. If you find that the connector was not properly secured, inspect the terminals for damage. If no damage is found, reconnect the barrel connector and clear the faults.			

91-14-05 Turn Signals Will Not Activate after TIPM Replacement			
Model(s)	Year	Eng.Code	Trans.Code
Routan	2011–2013	All	All
The replacement Totally Integrated Power Module (TIPM) contains revised software that changes the TIPM operation and alters the front exterior lighting of the vehicle. The vehicle wiring may need to be modified to maintain turn signal operation.			
Tip: Each repair kit comes with modification instructions.			
Model Year	New TIPM Repair Kits		
2011	7B0998049B		

2012	7B0998049
2013	7B0998049A

Campaigns

No new campaigns this week.

Updates

No new updates this week.

Suggestions

Please send comments or suggestions to: vwg.workshopinformation@vw.com

[Back to top](#)

© 2014 Volkswagen of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.