

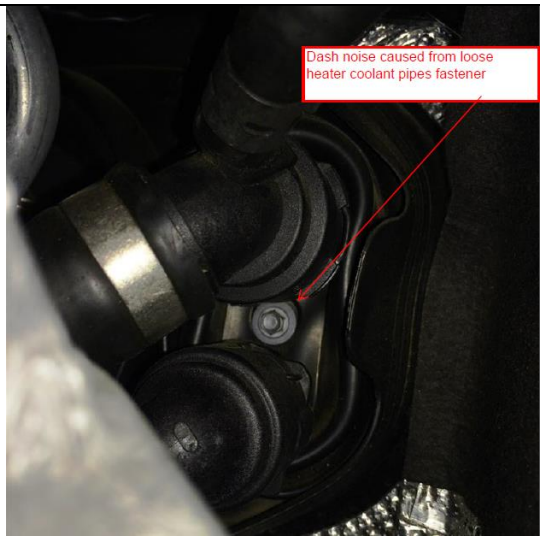

# Tech Tips

TT 80-15-01

Date: July 31, 2015

2015 Jetta 2.0I TDI (CVCA engine code) - Vibration/Rattle on acceleration, under mild/medium load

The Heater core pipe fastener may be loose allowing pipes to contact the bulk head causing a vibration. Inspect the fastener in the engine compartment that holds the heater core tubes to the air box assembly.

	<p>Inspect the heater core tube fastener</p> <ul style="list-style-type: none"><li>• If loose re-torque to 1.5Nm</li><li>• If screw is missing order substitute fastener WHT004564. Install and torque to 1.8Nm.</li></ul> <p><b>Note:</b></p> <p>Do not over torque the fastener. The plastic around the tubes may become deformed and damaged.</p>
	<p>Inspect the heater core clamps are not contacting the air box. Adjust the clamps away from the air box assembly. Tighten clamp screws 2Nm.</p>