

JTB00582NAS1

TECHNICAL BULLETIN

26 OCT 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION**SECTION:**

501-19: Bumpers

SUBJECT/CONCERN:

Front Bumper Lower Center Lip - Distortion at High Speed

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
F-PACE (X761)	2017-2018	045068-099999	Solihull

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
F-PACE (X761)	2017	488000-499999	Solihull
F-PACE (X761)	2017-2018	880002-899999	Solihull
F-PACE (X761)	2018 Onwards	240000 Onwards	Solihull

MARKETS:

NORTH AMERICA

CONDITION SUMMARY:

SITUATION:

Only on vehicles with standard front bumpers, the front bumper lower center lip may distort at high speed, detach from the front bumper, and/or create a noise from the front of the vehicle at high speed.

CAUSE:

This may be caused by front bumper build quality, leading to partial detachment of the front bumper lower lip and/or wheel arch liners.

ACTION:

Should a customer express concern, follow the Workshop Procedure below.

PARTS:

NOTE:

* - an allowance (\$228.06 USD or local equivalent) has been provided to cover the cost of the. Claim using Sundry Code 'ZZZ001'.

PART NUMBER	DESCRIPTION	QUANTITY:
T4A5641LML	Front Bumper - Except headlamp powerwash; except park side flank guard; except front parking aid; except automated parking assistant	1
T4A5642LML	Front Bumper - Except headlamp powerwash; except park side flank guard; front parking aid; except automated parking assistant	1
T4A5643LML	Front Bumper - Headlamp powerwash; except park side flank guard; except front parking aid; except automated parking assistant	1
T4A5644LML	Front Bumper - Headlamp powerwash; except park side flank guard; front parking aid; except automated parking assistant	1
T4A5645LML	Front Bumper - Except headlamp powerwash; except park side flank guard; front parking aid; perpendicular park assist	1
T4A5645LML	Front Bumper - Except headlamp powerwash; park side flank guard; front parking aid; except automated parking assistant	1
T4A5645LML	Front Bumper - Except headlamp powerwash; park side flank guard; front parking aid; perpendicular park assist	1
T4A5646LML	Front Bumper - Headlamp powerwash; except park side flank guard; front parking aid; perpendicular park assist	1
T4A5646LML	Front Bumper - Headlamp powerwash; park side flank guard; front parking aid; perpendicular park assist	1
T4A5646LML	Front Bumper - Headlamp powerwash; park side flank guard; front parking aid; except automated parking assistant	1
*ZZZ001	Paint and materials	\$228.06 USD

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:**NOTE:**

* - an allowance (\$228.06 USD or local equivalent) has been provided to cover the cost of the. Claim using Sundry Code 'ZZZ001'.

NOTES:

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.
- The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Front bumper assembly - Renew	76.22.78	2.2	33	T4A5641LML, T4A5642LML, T4A5643LML, T4A5644LML, T4A5645LML, T4A5646LML

NOTE:

Normal Warranty procedures apply.

WORKSHOP PROCEDURE:

- 1 Replace the front bumper assembly (see TOPIx Workshop Manual section 501-19: Bumpers - Removal and installation - Front Bumper).