

JTB00592NAS1

**TECHNICAL BULLETIN**

24 OCT 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

**INFORMATION****SECTION:**

211-05: Steering Column Multifunction Switch

**SUBJECT/CONCERN:**

Indicator / Wiper Stalks Inoperative or Intermittent Function

**AFFECTED VEHICLE RANGE:**

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
F-PACE (X761)	2017-2018	045068-099996	Solihull
F-PACE (X761)	2017	488002-499998	Solihull
F-PACE (X761)	2017-2018	880002-899997	Solihull

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
F-PACE (X761)	2018 Onwards	240000 Onwards	Solihull
XE (X760)	2017	921222-979442	Solihull
XE (X760)	2016 Onwards	P10168 Onwards	Castle Bromwich
XF (X260)	2016 Onwards	Y00461 Onwards	Castle Bromwich

---

## MARKETS:

NORTH AMERICA

---

## CONDITION SUMMARY:

## SITUATION:

The lighting control switch and/or the wiper control switch may not operate or operates intermittently.

## CAUSE:

This may be caused by a poor electrical connection at the lighting control switch and/or the wiper control switch.

## ACTION:

Should a customer express concern, follow the Workshop Procedure below.

---

## PARTS:

### NOTE:

One (1) tube of Nyogel electrical lubricant sufficient for 10 vehicles.

PART NUMBER	DESCRIPTION	QUANTITY:
C2D45634	Nyogel electrical lubricant	1

---

**TOOLS:**

Refer to Workshop Manual for any required special tools.

**WARRANTY:****NOTES:**

- Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.
- The JLR Claims Submission System requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Lighting and wiper control switches - Apply Nyogel	86.94.99	0.3	42	T4N4335

**NOTE:**

Normal Warranty procedures apply.

**WORKSHOP PROCEDURE:**

1

**NOTE:**

The lighting control switch/wiper control switch may also be referred to as steering column multifunction switch.


Remove the lighting control switch (see TOPIx Workshop Manual section 211-05: Steering Column Multifunction Switch).

- Reconnect and disconnect the lighting control switch twice to clean the electrical contact points.

2

**NOTES:**

- Do not apply Nyogel to the lighting control switch connector.
- Make sure there is an even coating of Nyogel on the electrical contacts surface.
- Remove any excess Nyogel.

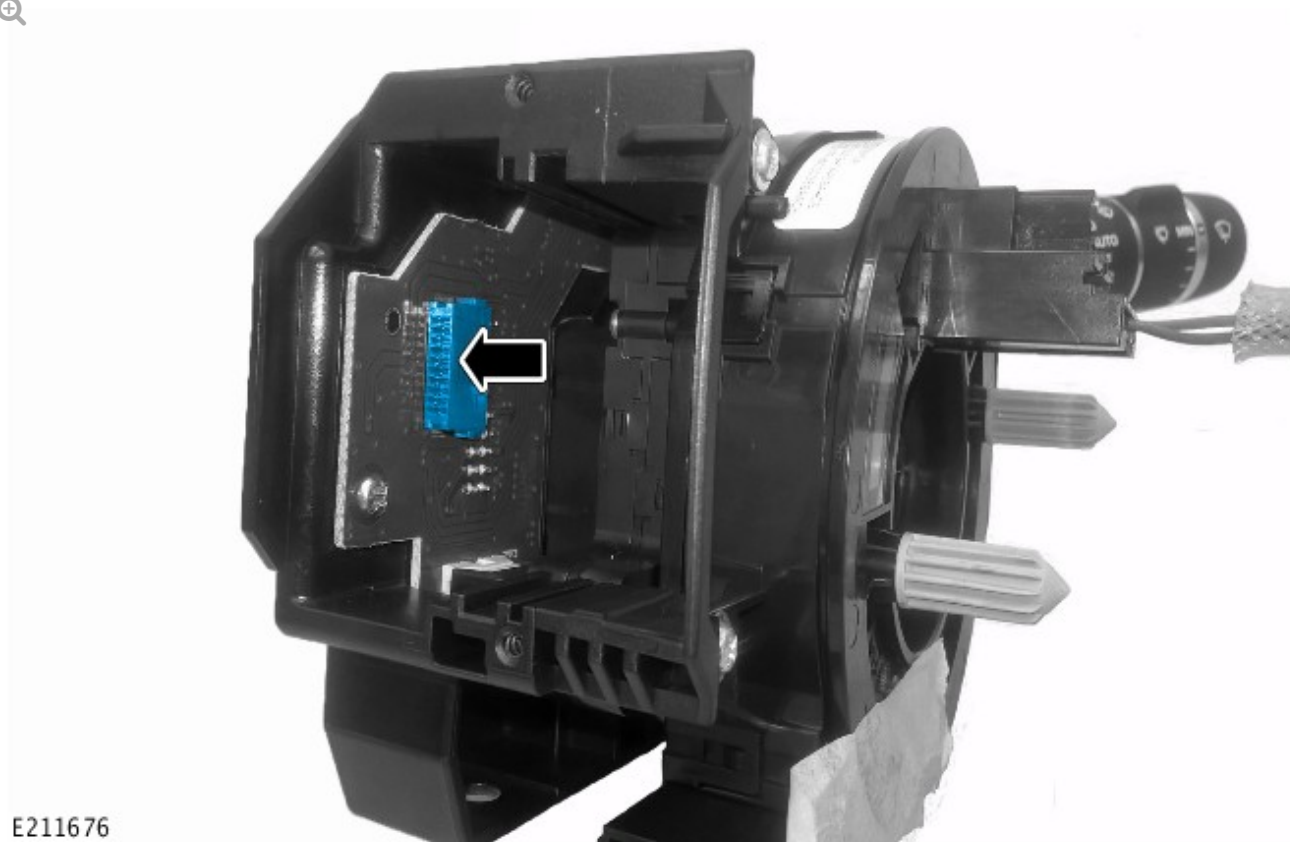

With the lighting control switch removed, apply the Nyogel to the electrical contacts surface.

3 Repeat steps 1-2 for the wiper control switch.

4 To install, reverse the removal procedure.