## Technical Service Bulletin

#### 37 Transmission warning message in cluster (DTC P060A00)


37 13 02 2029027/7 April 26, 2013. Supersedes Technical Service Bulletin Group 37 number 13-99 dated April 1, 2013 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
A4,A5, A5 Cabriolet	2011-2013	All	8 speed 0BK Transmission	
Q5 2.0T	2011-2013	All	8 speed 0BK Transmission	
A6/A7	2013	All	8 speed 0BK Transmission	
A8, A8L, A8W12, S8	2011-2013	All	8 speed 0BK Transmission	

### **Condition**

REVISION HISTORY				
Revision	Date	Purpose		
7	-	Revised Service (Updated SVM table, ECM update added for A8 4.0T and S8)		
		Revised Warranty (reflected changes in Service section)		
6	4/1/2013	Revised Service (Updated SVM table)		
5	12/19/2012	Revised Service (Updated SVM table)		
4	9/27/2012	Revised <i>Header</i> data		
3	7/11/2012	Revised Service (Updated SVM table)		
2	6/28/2012	Revised Service (Changed wording)		
1	3/15/2012	Original publication		

- Customer may report transmission warning light is illuminated. In some cases, the vehicle will not move after being started and placed into gear. After key cycle, the vehicle drives without restriction.
- One of the following DTCs is stored in the transmission control module (TCM), J217 (02):
  - DTC P060A00 (Internal Control Module Monitoring Processor Performance) with DFCC 8692
  - DTC P060A00 (Internal Control Module Monitoring Processor Performance) with DFCC 8694
  - DTC P060A00 (Internal Control Module Monitoring Processor Performance) with DFCC 12480

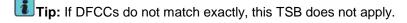

## Technical Service Bulletin

## **Technical Background**

The DTCs are stored due to an issue with the transmission control module software. Specific DFCCs are stored as a result of the following situations:

- **DTC P060A00** with **DFCC 8692** can be logged when a driving mode (Drive or Reverse) is selected within one second of selecting Neutral, while the vehicle rolls at a speed less than 2 mph (such as when the vehicle is being maneuvered in or out of a parking spot).
- DTC P060A00 with DFCC 8694 can be logged when the gear is quickly changed from Park to Neutral, due to a
  low diagnosis threshold.
- DTC P060A00 with DFCC 12480 can be logged when the gear is changed using the Tiptronic function, due to a low diagnosis threshold.

### **Production Solution**

- New software in the Transmission Control Module (TCM), J217 (02), addressed the condition.
- For the A8 4.0T and S8 models, there is new software in Engine Control Module (ECM), J623 (01) that should be used in combination with new software in the Transmission Control Module, J217 (02), which addresses the condition.

### **Service**

 Ensure that the DFCCs match exactly before proceeding. The DFCC is the 4-6 digit code in front of the P code, as pictured (Figure 1).

#### 02 - Transmission Electronics (0BK tiptronic) 8kD927158K 0BK 20TFSIUSA Coding 001112 0BK927156N H08 0010

1Event(s) detected

Event memory 1:

8692 P060A00 [32] Control module internal processor monitoring Sporadic

Ambient requirements:

Standard values:

Date
Time
km-Mileage
Param\_DTCPrior
Occurence Counter
Central-Aging-Counter

11.07.2011 08:29:39 3719 km 2 1

Figure 1. Locating the 4-6 digit DFCC code.

# Technical Service Bulletin

2. Update the software using the SVM Update Instructions below.

#### **SVM Update Instructions**

- 1. Follow all instructions in the attached TSB, 2011732 00 Software Version Management (SVM), operating instructions.
- 2. Update the TCM using the SVM action code as listed in the table below if necessary.
- 3. For A8 4.0T and S8 vehicles, update the ECM and the TCM, if necessary. The update may have already been performed in TSB 2033726.

Model	Engine and/or Transmission	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Action Code
	Tra	Insmission Software	Undate (exc	ent Δ8 4 0T and S8)	(or riighter)	
A4, A5, A5 Cabriolet	2.0L with 8 speed Transmission	8K0927158K	All	8K0927158K	1014	02A048
A4, A5, A5 Cabriolet	2.0L with 8 speed Transmission	8K0927158Q or 8K0927158S	All	8K0927158S	1007	02A048
Q5	2.0L with 8 speed Transmission	8R0927158E	All	8R0927158E	1015	02A048
Q5	2.0L with 8 speed Transmission	8R0927158T	All	8R0927158T	1009	02A055
Q5	2.0L with 8 speed Transmission	8R0927158M	All	8R0927158M	1008	02A048
A6, A7 A8, A8L	3.0L with 8 speed transmission 4.2L with 8 speed transmission	4G0927158E or 4G0927158P	All	4G0927158P	1006	02A055
		4H1927158M	All	4H1927158M	1007	02A041
		4H1927158N		4H1927158N	1007	
		4H1927158AD		4H1927158AD	1007	
		4H1927158AQ		4H1927158AQ	1004	



# Technical Service Bulletin

	1				1	_
A8L	6.3 W12 with 8 speed transmission	4H1927158T	All	4H1927158T	1009	02A055
A8 4.0T and S8 Transmission and Engine Software Update						
Model	Engine and/or Transmission	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version	SVM Action Code
					(or higher)	
A8, A8L	4.0T CEUA	4H0906014B	0002	4H0906014B	0003	
	8 speed transmission and Sport Diff	4H1927158CA	All	4H1927158CA	1005	
	8 speed transmission	4H1927158BK	All	4H1927158BK	1005	01A134
\$8	4.0T CGTA	4H0907557B	0003	4H0907557B	0004	
	8 speed transmission	44H1927158BL	All	4H1927158BL	1005	

<sup>4.</sup> Clear adaptations and perform test drive adaptation through GFF for 2011 model year.

<sup>5.</sup> Clear adaptations and perform standstill adaptation for 2012 or 2013 model year.

## Technical Service Bulletin

## **Warranty**

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.				
Service Number:	3730				
Damage Code:	0039				
Labor Operations:	ns: Update TCM Software 3730 2599 40				
	Update ECM and TCM Software (A8 4.0T/S8 only)	2470 2599	60 TU		
	Perform standstill adaptation	3735 5799	60 TU		
	-OR-				
	Perform test drive adaptation	Included in GFF below			
Diagnostic Time:	GFF to perform test drive adaptation	0150 0000	Time stated on diagnostic protocol (Max 100 TU)		
	Road test prior to service procedure	No allowance	0 TU		
	Road test after service procedure 2012 only. Included in adaptation drive for 2011.	0121 0004	10 TU		
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)				
Claim Comment:	: As per TSB #2029027/7				

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

### **Additional Information**

The following Technical Service Bulletin will be necessary to complete this procedure:

• TSB 2011732 00 Software Version Management (SVM), operating instructions.

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.