

Technical Service Bulletin



85 Lack of heating or air conditioning

85 14 20 2033596/3 February 24, 2014. Supersedes Technical Service Bulletin Group 85 number 13-17 dated May 15, 2013 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2009 - 2013	000001 - 999999	Not Applicable
A4	2014	A000001 - A079695 N000001 - N023000	Not Applicable
A5	2008 - 2013	000001 - 999999	Not Applicable
A5	2014	A000001 – A037615 A900000 – A901210	Not Applicable
Q5	2009 - 2013	000001 - 999999	Not Applicable
Q5	2014	000001 - 060911	Not Applicable
A5 Cab	2010 - 2013	000001 - 999999	Not Applicable
A5 Cab	2014	N000001 - N006000 N900000 – N900583	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised header data (Added model years)
2	5/15/2013	Revised <i>Condition</i> (Modified DTCs) Revised <i>Service</i> (Modified DTCs) Modified title
1	4/19/2013	Initial publication

One or more of the following DTCs may be stored in the heating and air conditioning electronics control module (address word 08):

- DTC 01844 004
- DTC 01844 014
- DTC 01273 009
- DTC 01273 006

Technical Background

Improper operation of the fresh air blower could be caused by one or both of the following root causes:

- A faulty printed circuit board in the fresh air blower control module, J126.
- The carbon brushes bind in the brush holder and, as a consequence, lose contact with the motor commutator of the fresh air blower, -V2-.

Production Solution

- Improved fresh air blower control module, J126.
- Improved brush assembly has been implemented in production.

Service

If either of the following DTCs are present, replace the fresh air blower control module, J126:

- **DTC 01844 004**
- **DTC 01844 014**

-OR-

If either of the following DTCs are present, replace the fresh air blower, -V2-:

- **DTC 01273 009**
- **DTC 01273 006**

If DTCs for both the J126 as well as the V2 are present, replace both the fresh air blower control module, J126 and the fresh air blower, -V2-.

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	8530		
Damage Code:	0040		
Labor Operations:	Blower remove and reinstall	8530 1900	70 TU
	-OR-		
	Blower regulator remove and reinstall	8778 1900	70 TU
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 30 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2033596/3		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
8K1820021C	Fan	1
-OR-		
8K0820521B	Blower control	1



Additional Information

All parts and service references provided in this TSB (2033596) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.