

Service Bulletin

File in Section:

Bulletin No.: 16-NA-223

Date: July, 2016

INFORMATION

Subject: Traction Control Light Flashes Under Hard Acceleration at Higher Road Speeds

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick Cadillac Chevrolet GMC	All GM Passenger Cars and Trucks	2009	2017			All	All

Involved Region or Country	North America and N.A. Export Regions			
Condition	Some customers may comment that under hard acceleration at higher speeds, the traction control light will flash. Or, they may come in for ABS or general handling/braking concerns.			
	This may be noticed after a new set of tires have been installed on the vehicle.			
Cause	This may be caused by tires installed not meeting the same tread wear, traction, or temperature ratings.			

Correction

Inspect/ensure that the correct O.E TPC tires are installed on any vehicle that may be in for Service for a traction, stability, ABS or general handling/braking concern. The O.E. tire information can be found in the Parts Catalog by searching using the VIN. The correct size and manufacture of tires will be displayed. U.S. Dealers can also use the fitment guide on www.gmtirebilling.com, or they can call the Tire Hotline at 877-728-4737. If the OE TPC tires are no longer available, then ensure the replacement tires are the same type (summer or all season), size and have the same or higher load and speed rating.

Version	1
Modified	

