

Preliminary Information

PIP5472C Short Duration Misfire - Rough Idle - MIL On During Cold Start - P050D

Models

Brand:	Model:		Model Years:	VIN:		Engine:	Transmissions:	
Biand.				from	to	Liigille.	Transmissions.	
Buick	Encore		2016 - 2018	All	AII	1.4L (RPO LE2)	All	
Chevrolet	Cruze		2016 - 2018	All	AII	1.4L (RPO LE2)	All	
Chevrolet	Equinox		2018	All	AII	1.5L (RPO LYX)	All	
Chevrolet	Malibu		2016 - 2018	All	AII	1.5L (RPO LFV)	All	
Chevrolet	Spark		2016 - 2018	All	AII	1.4L (RPO LV7)	All	
Chevrolet	Volt		2016 - 2018	All	AII	1.5L (RPO L3A)	All	
GMC	Terrain		2018	All	AII	1.5L (RPO LYX)	All	
Involved Region or Country North America								
Condition		l	ort duration cold start rough idle, MIL on, P050D with or without P0300 at ambient temperatures tween -10C and +5C (14F to 41F).					
Cause		l	one or more exhaust SHLA's (Stationary Hydraulic Lash Adjuster) may not bleed off the cold, thick ngine oil, causing the exhaust valve not to seal the cylinder for a short duration during cold starts.					

Correction:

If you encounter the P050D with misfires that occur only during the first 15 to 30 seconds of cold start, then replace all Exhaust SHLA's. (Stationary Hydraulic Lash Adjuster)

Do not replace the intake side SHLA's as a slow leak rate on the intake side will not cause this issue.

Repair Verification requires a cold start.

After SHLA replacement, following a cold soak at ambient temperatures between -10C and +5C (14F to 41F) start the engine and retest for short duration misfires or the P050D.

Warranty Information

Labor Operation	Description	Labor Time
4061270	Hydraulic Valve Lash Adjuster Replacement	Use Published Labor Operation Time

Version History

	4		
Version	2/23/2017 - to add 2016-2017 Chevrolet Volt to models list.		
Version	3/09/2017 - to add 2018 to all models.		
	12/11/2017 - to add 2018 GMC TERRAIN		



















