



# Technical Journal

TITLE:

**Road noise heard from B-pillar**

<b>REF NO:</b> TJ 30853.2.0	<b>ISSUING DEPARTMENT:</b> Technical Service	<b>CAR MARKET:</b> United States and Canada	
<b>PARTNER:</b> 3 US 7510 Volvo Car USA		<b>ISSUE DATE:</b> 2015-11-09	<b>STATUS DATE:</b> 2016-07-11
<b>FUNC GROUP:</b> 8000	<b>FUNC DESC:</b> Body, cab and interior	Page 1 of 10	

“Right first time in Time”

## Attachment

File Name	File Size
TJ 30853.pdf	2.7680 MB

## Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
256							2016-2017	21	0000561-0118593	201505-201624

## CSC Customer Symptom Codes

Code	Description
C4	Complete vehicle/Unusual noise/While driving
F3	Complete vehicle/Unusual noise/During acceleration
F6	Complete vehicle/Unusual noise/During deceleration

## VST Operation Number

VST Operation Number	Description
98615-2	B-pillar 2 sides adjusting acc. TJ30853

## DTC Diagnostic Trouble Codes

Rows beginning with \* are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.



## Text

### DESCRIPTION:

\* TJ updated with chassis breakpoint and structure week end date.  
Customer may experience some road noise coming from the B-pillar belt adjuster area.

### SERVICE:

In case of customer complaints perform repair according to attached instruction.

### VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support Not Needed", use function group 8000.

**To view TJ attachment continue to next page. This TJ has one attachment.**



## Volvo Car Customer Service

TJ 30853

<b>Title</b>	B-pillar trim panel	<b>Page</b>	1 ( 8 )
<b>Action</b>	Removal	<b>Operation number:</b>	98615-2

### Affected vehicles

Model year	Model
2016	XC90 (16-)


### Materials


Materials	Qty.	Part No.	Notes
Seal	4.0	30779754	
Flange screw	4.0	985037	
Sealing	2.0	9444459	
Insulating mat	2.0	30721688	

**Removal**


**Note! Removal steps in this procedure may contain installation details.**

**Orientation view**

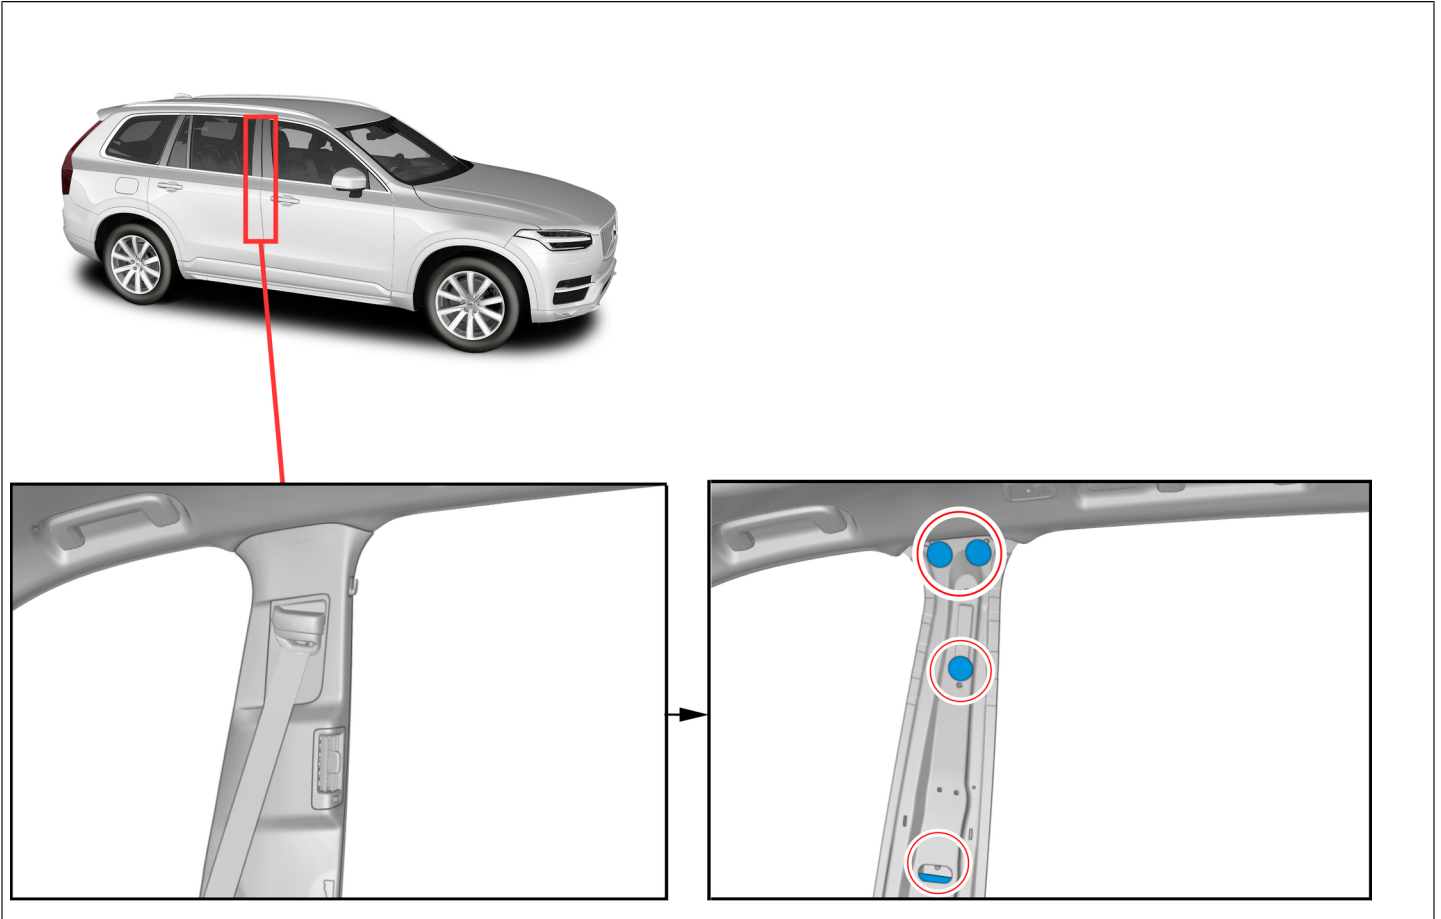


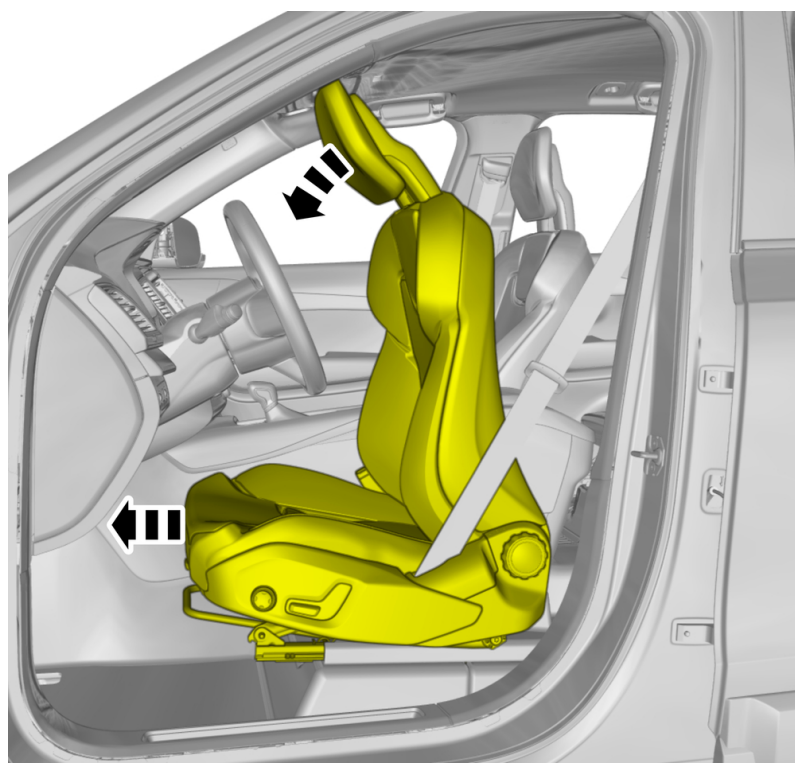


On both sides.

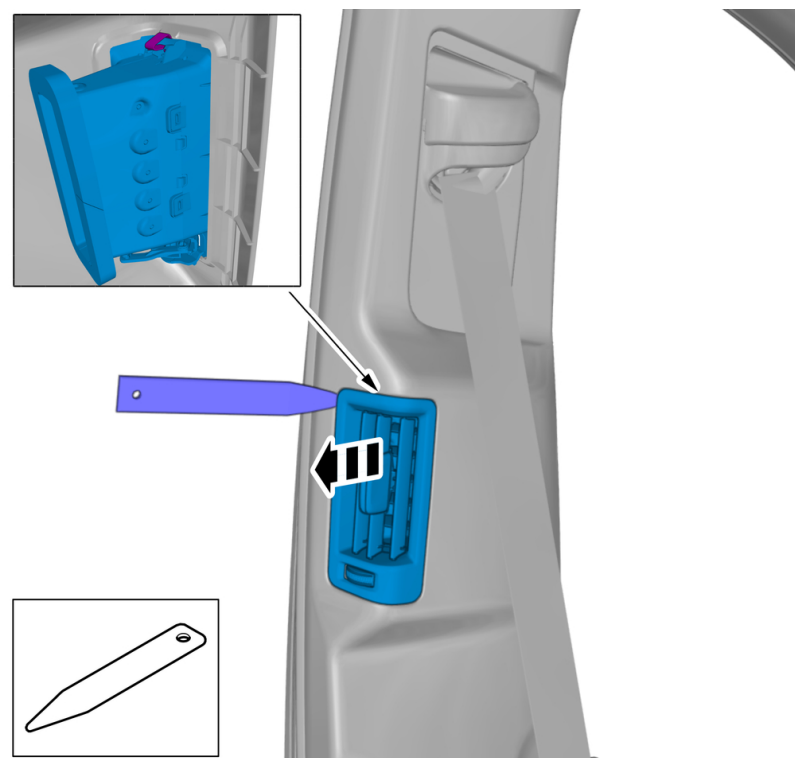


Remove the marked part.  
On both sides.

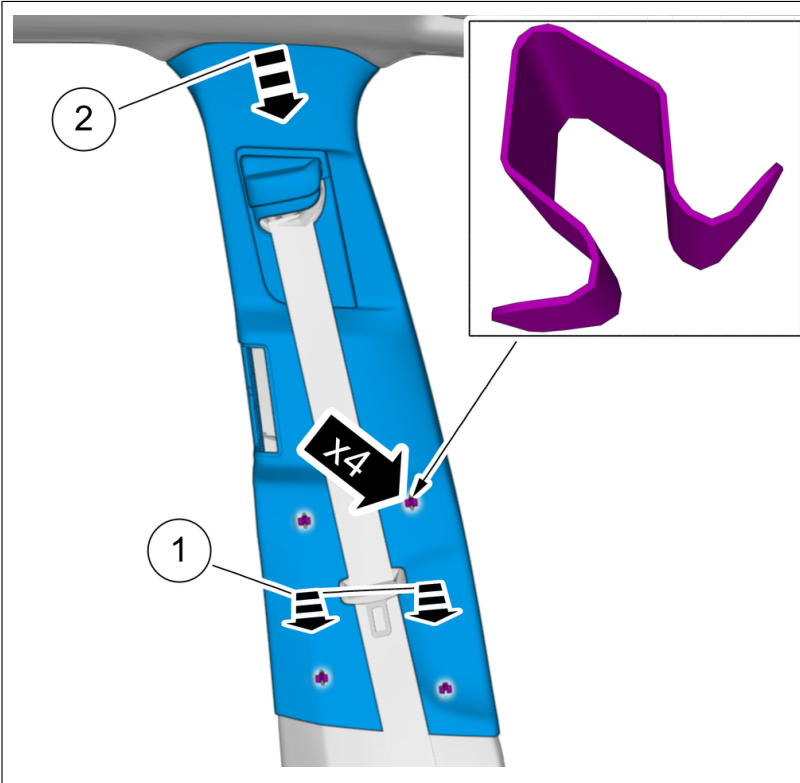

Remove the panel.  
On both sides.

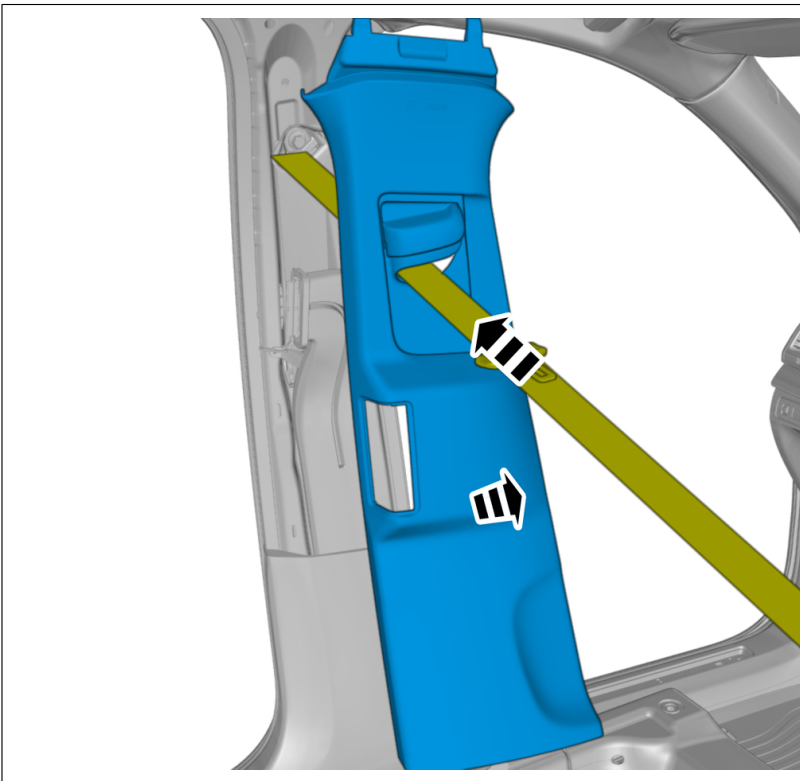

Remove the panel.  
On both sides.

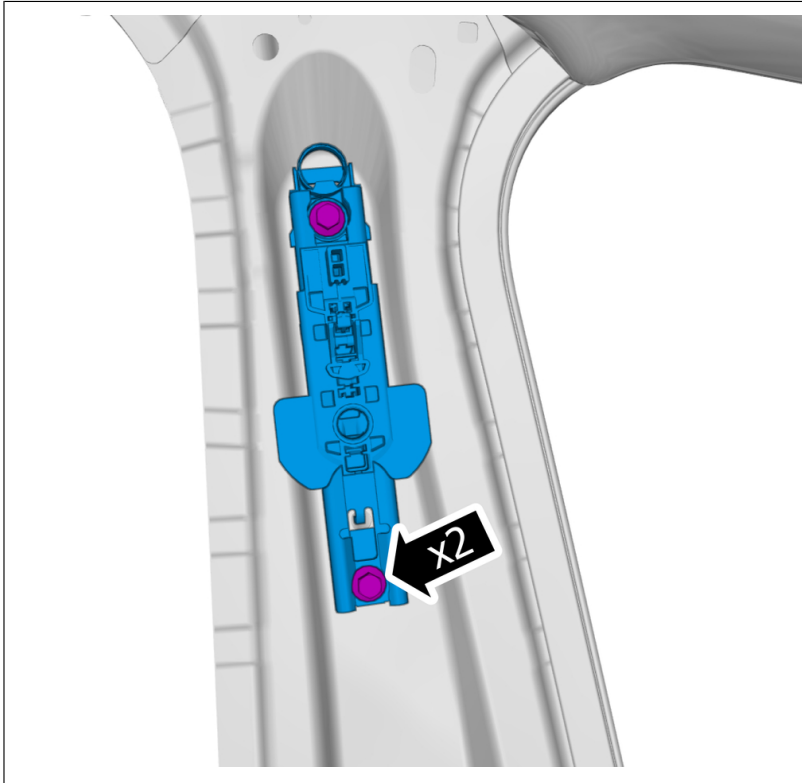

**Caution! Make sure that new bolts are installed.**


**Torque:**

M8 , 24 Nm

Remove the screws.

Remove the marked part.


On both sides.

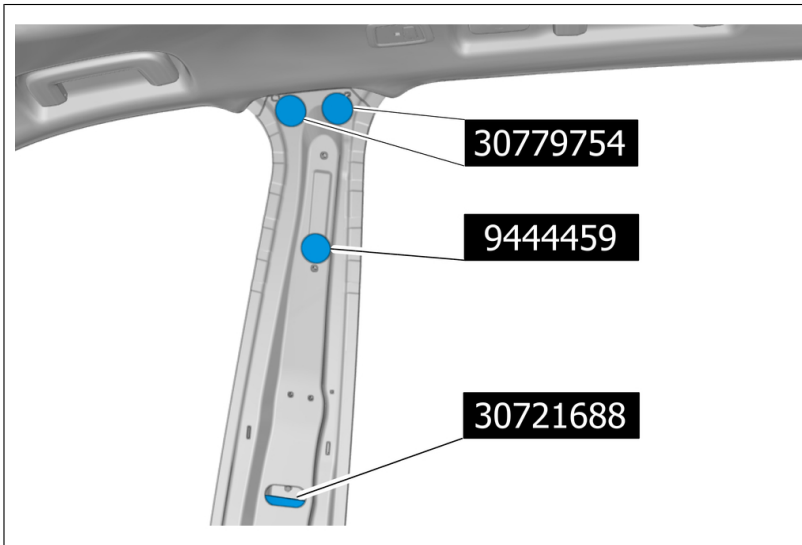

**Note! Orientation view**


On both sides.

**Use:** Seal , 30779754

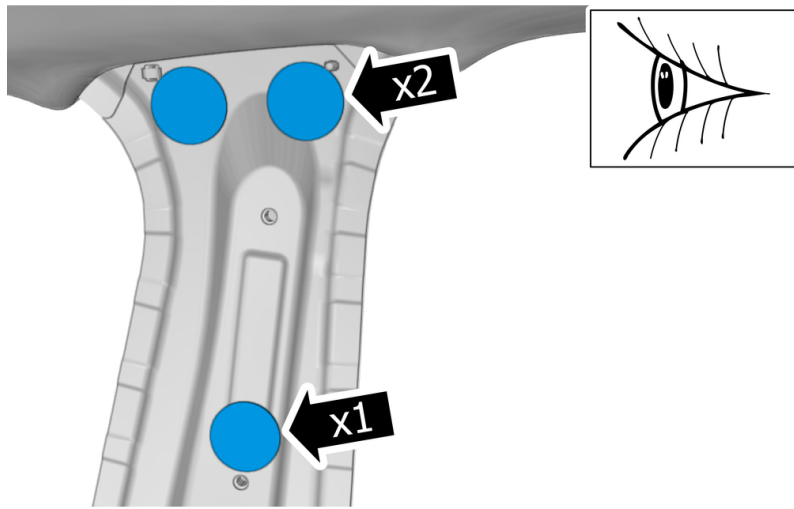

**Note! Note the position.**



On both sides.

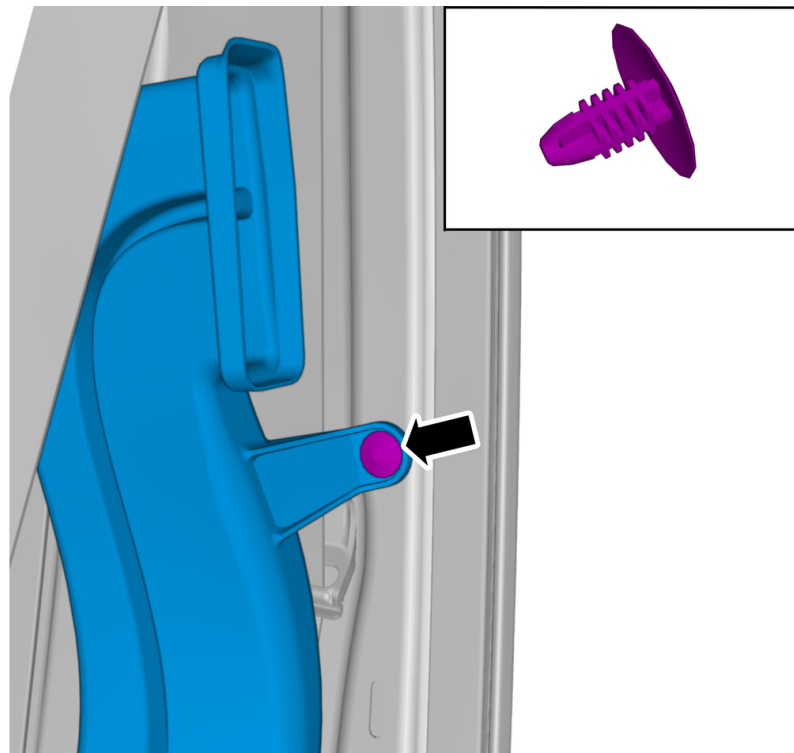


Remove the clip.

On both sides.



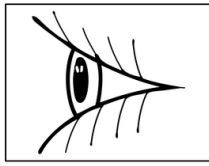
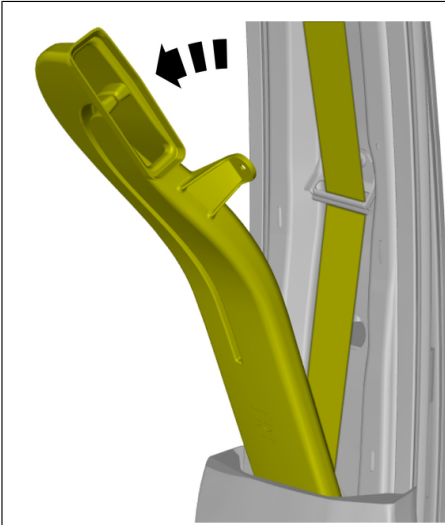


Fold marked part to one side.  
On both sides.

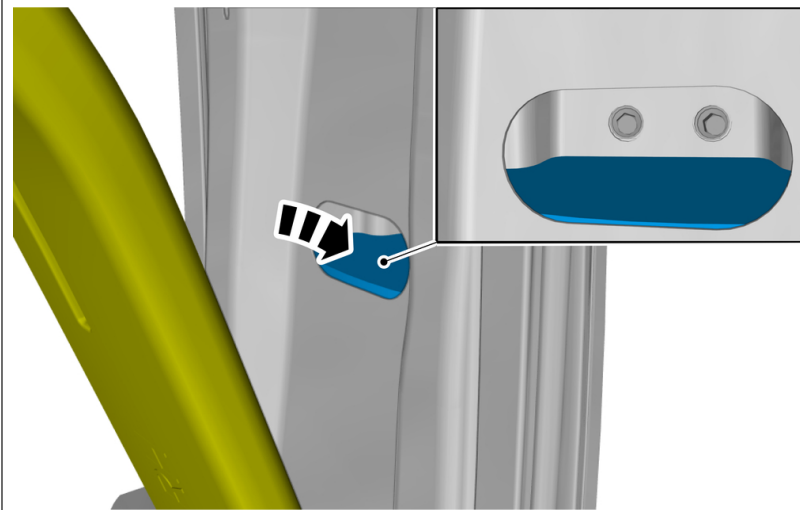

**Note! Note the position.**  
On both sides.

Installation

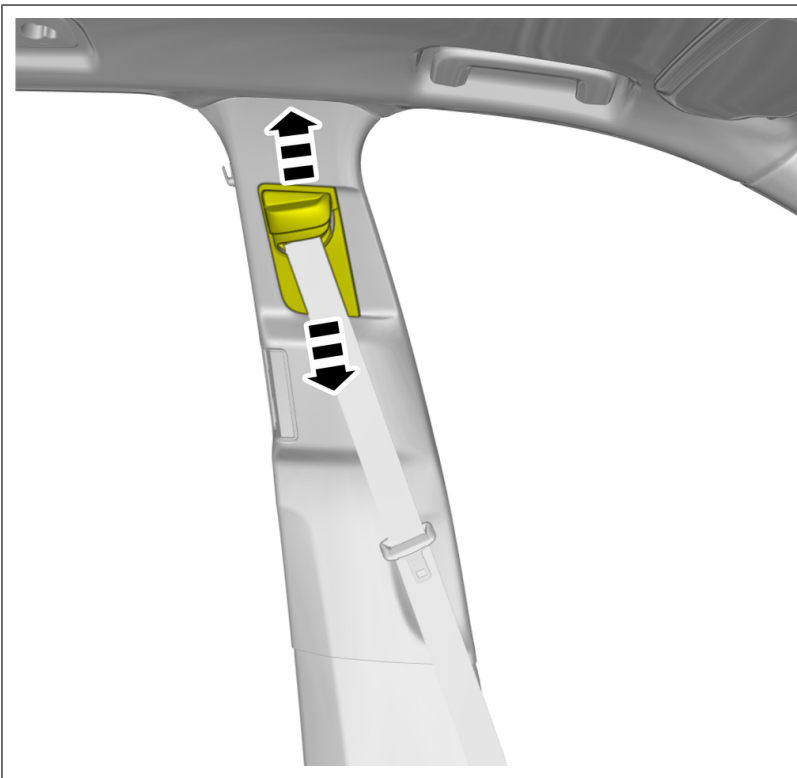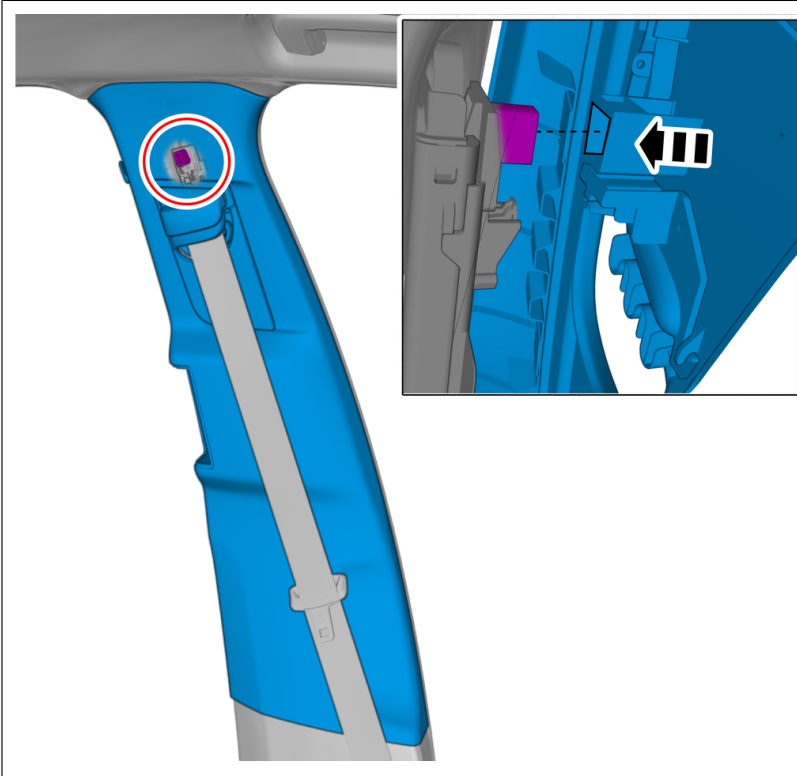

Check for correct operation.

To install, reverse the removal procedure.