

Service Program Trucks

Date Group No. Release Page 4.2013 **431 021 01** 1(6)

Transmission ECU Programming OBD2013, D11H, D13H, D16H VHD, VN

SP 431-021, Transmission ECU Programming

(April 2013)

Information

Software updates with enhancements are available for the Transmission Electronic Control Unit (TECU). This software update has been released to resolve issues for loss of calibration and the ability to enable single PTO functionality.

Required Tools

Premium Tech Tool version 2.01.45 or higher

Diagnostic Connector 88890304

Communication Interface 88890300 with firmware 1.12.0.2 or higher

Procedure




DANGER

Do not attempt to repair or service this vehicle without having sufficient training, the correct service literature and the proper tools. Failure to follow this could make the vehicle unsafe and lead to serious personal injury or death.

- 1 Verify service program eligibility by checking service program status in eWarranty.
- 2 Connect Premium Tech Tool (PTT) to the vehicle diagnostics connector using the 16 pin OBD cable 88890304 and Communication Interface 88890300. Connect the PC to a functional LAN or modem connection and a 120 Volt AC source (do not use intermediate storage).
- 3 Turn the ignition switch "ON" and Identify Vehicle is displayed.

4 Once the vehicle has been identified, enter the Work Order Number information, then click Start Work.

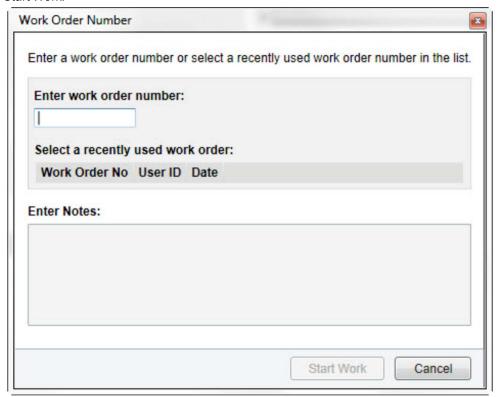


W2079940

5 From the Main Menu select Program and **then** Program Electronic Control Unit 1700-08-03-39. Then click Start.




W2079941

6 Select Transmission ECU (TECU) from the list.

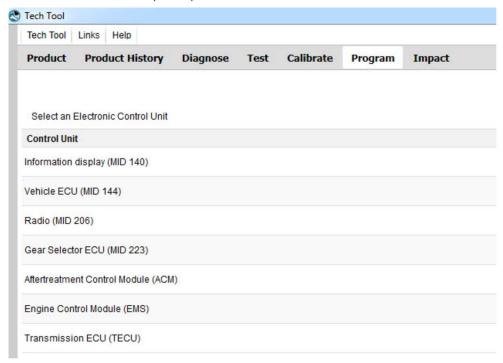

W2079943

7 Select Program to update the electronic control unit with the latest software.

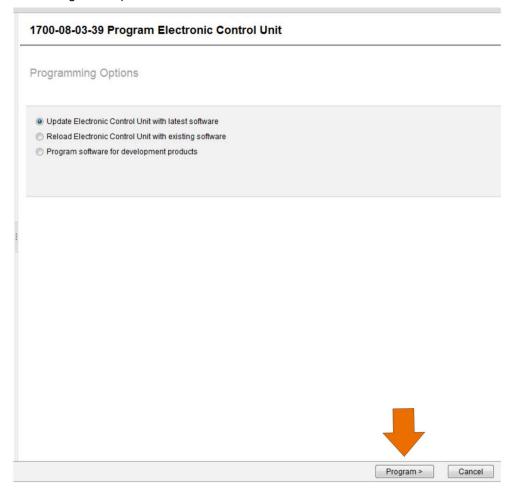

W2079942


8 Certain conditions must be met to continue with programming: battery voltage above 10v, parking brake applied, and ignition key in ON position with engine not running. When all conditions have been met, click Continue to proceed with programming.



W2080113

9 When programming is complete, click Exit to return to Main Menu.

10 Once TECU programming is complete, select Calibrate from the Main Menu. Select 4320-07-03-01 Transmission and clutch, pulling position and click on Start

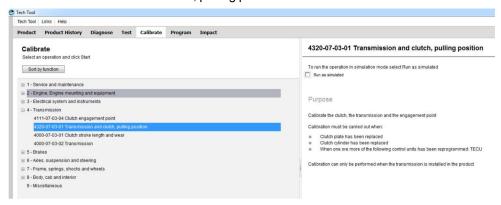

W2079944

11 When calibration is complete, clear any diagnostic trouble codes and Finish Work.

Reimbursement

This repair is covered by an authorized Service Program. Reimbursement is obtained via the normal claim handling process.	
Claim Type (used only when uploading from the Dealer Bus. Sys.)	В
Recall Status	
Vehicle inspected, repair not required	1- Inspected OK
Vehicle repaired per instruction	2- Modified per instruction
Labor Code	
Primary Labor Code	43122-0-02 — 0.4 hrs.
Time to take charge and determine campaign status	17003–0–0 — 0.3 hrs.
Causal Part	3092515
Authorization Number	SP431021
Expiration Date	30-SEPT- 2013

Note: Take Charge Time is not included in the Labor Code for this operation. Take charge may be eligible but can only be used once per repair visit. If vehicle is having other warranty repairs performed, take charge should be charged to the warranty repair, otherwise take charge can be charged to this service program.