



Technical Service Bulletin

| | |
|--------------------------------------------------------------------|-----------------------------------|
| Technical Service Bulletin: TSB140019 | Released Date: 17-Nov-2017 |
| Fuel Pump - Plunger and Tappet Roller Inspection and Repair | |

Fuel Pump - Plunger and Tappet Roller Inspection and Repair

Warranty Statement

The information in this document has no effect on present warranty coverage or repair practices, nor does it authorize TRP or Campaign actions.

Contents

Product Affected


- ISX12 CM2350 X102
- ISX12/ISX11.9 CM2250
- ISX15 CM2250
- ISX15 CM2250 SN
- ISX15 CM2350 X101
- PowerGen QSX15 CM2250
- PowerGen QSX15 CM2250 ECF
- QSX11.9 CM2250 ECF
- QSX15 CM2250 ECF
- QSX15 CM2350 X105
- QSX15 CM2350 X106

This document, in conjunction with the information provided within the manuals listed in Table 1 provides inspection and repair guidelines following the malfunction of a fuel pump pumping plunger and/or roller tappet assembly.

The level of progressive damage to the fuel pump and other engine components will vary with every incident; however, the repair direction will depend on **only** a few key criteria.

Previous versions of this document provided specific repair directions according to the vintage of the fuel pump and type of pumping plungers. Repair directions have now been made common and apply to all fuel pumps regardless of vintage, pumping plunger type, or tappet roller assembly type.



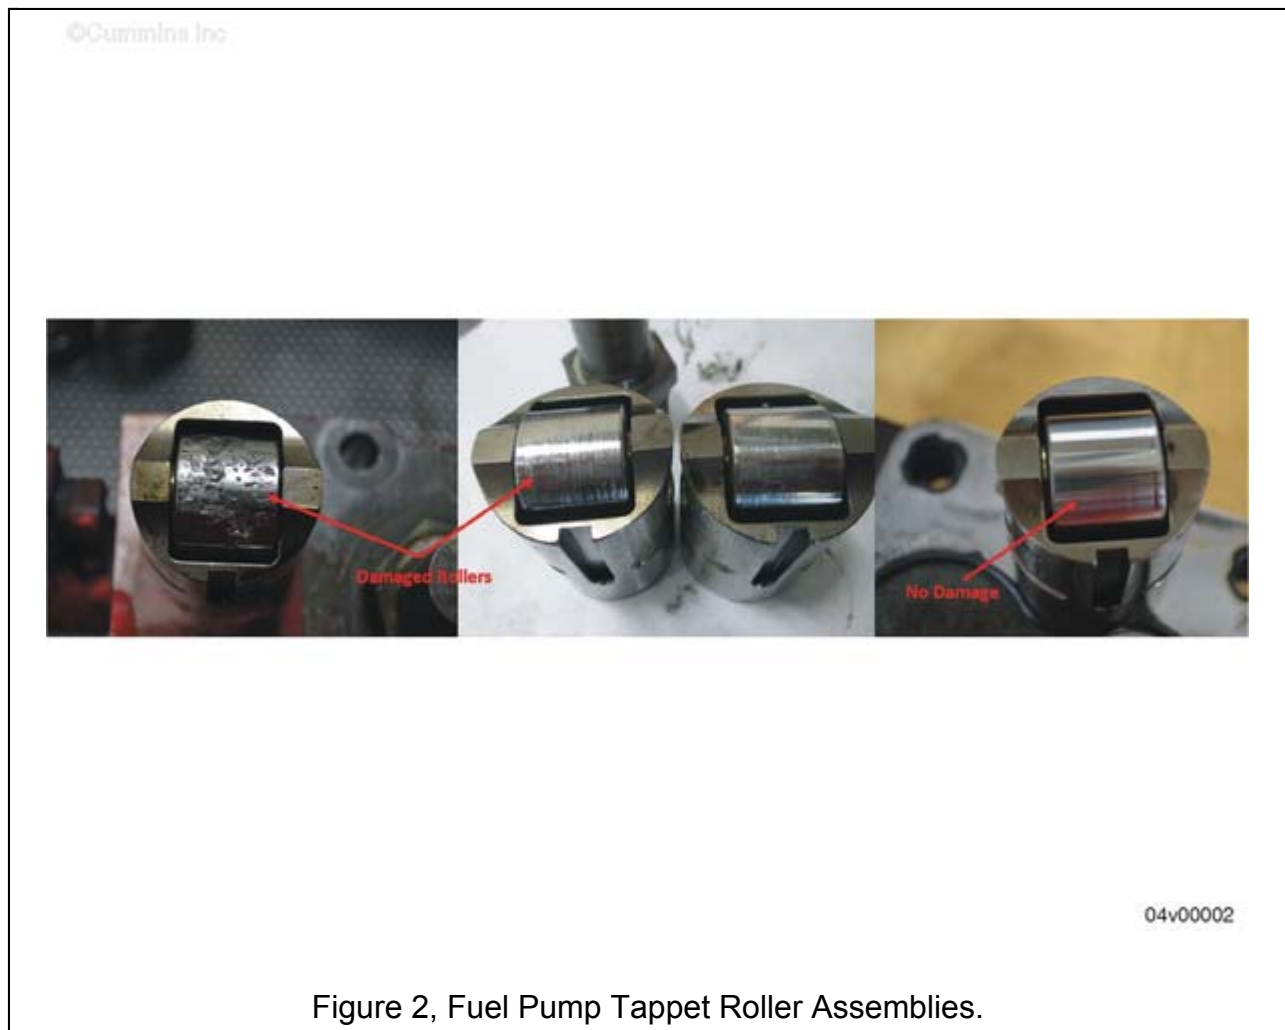

Preliminary Inspection and Repair Direction for all Fuel Pump Malfunctions

If a broken tappet spring or spring retainer is found, see Technical Service Bulletin, Fuel Pump Head Barrel Assembly Serviceability – Spring and Spring Retainer, TSB170015 for repair direction.

Inspect and verify the condition of the fuel pump tappet rollers and fuel pumping plungers if ceramic (CM2250 only). Reference Figure 1 and Figure 2 above and Procedure 005-227 in Table 3 below.

Scenario 1: The fuel pump tappet rollers are damaged or ceramic pumping plunger damage is found:

- Remove, cut open, and inspect the lubricating oil filter for debris. See Procedure 007-083 in Table 3.
- Connect INSITE™ electronic service tool to the service tool data link and review any logged fault codes.
- Reference Table 1 below for repair direction.

Scenario 2: The fuel pump tappet rollers and ceramic pumping plungers are **not** damaged:

- Connect INSITE™ electronic service tool to the service tool data link and review any logged fault codes. Follow appropriate fault code or symptom based troubleshooting in EDS or QuickServe® Online (QSOL).

| Table 1, Repair Direction Decision Matrix | | |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------------------------|-----------------------------------|
| Symptoms | Are Any Symptoms Present? | Repair Direction to Follow |
| <ul style="list-style-type: none"> • Non-wear debris or particles are evident in the lubricating oil filter element. • Fault Codes 415 or 143 are logged in the engine control module (ECM) within the last 8 hours of engine operation. • Engine is seized, or engine rotating assembly produces abnormal noise. | Yes | Repair Direction A |
| | No | Repair Direction B |

⚠ CAUTION ⚠

Immediately upon removal of the lubricating oil cooler assembly, a plug must be inserted into the housing and cylinder block oil passage drillings. Failure to insert the oil passage plug can result in a bearing failure, crankshaft failure, or both.

⚠ CAUTION ⚠

Do not allow dirt or foreign material to enter oil passages in the cylinder block when cleaning the gasket sealing surfaces. Connecting rod bearing failures can be caused if debris is introduced into the cylinder block or lubricating oil cooler housing oil passages. Therefore, use of power tools combined with abrasive pads to clean gasket surfaces is not recommended.

Repair Direction A:

1. Drain lubricating engine oil. See Procedure 007-037 in Table 3.
2. Remove lubricating oil pan, and clean thoroughly. See procedure 007-025 in Table 3.
3. Remove and inspect lubricating oil pump for reuse. See Procedure 007-031 in Table 3.
4. Remove number 1 and number 4 main bearing caps and main bearings. See procedure 001-006 in Table 3.
5. Inspect number 1 and number 4 main journals of crankshaft for reuse. See Service Bulletin Crankshaft Reuse Guidelines for Cummins® Engines, Bulletin 5411180.
 - If crankshaft meets reuse guidelines:
 - Inspect number 1 and number 4 main bearings for signs of significant debris embedding. If significant debris is found, remove number 1 and number 4 connecting rod bearings for inspection.
 - If damage is observed on number 1 and number 4 connecting rod bearings, roll new connecting rod bearings in on all six journals. See Procedure 001-006, 001-007, and 001-014 in Table 3.
 - Roll new main bearings in on all seven main journals and install new thrust bearings on number 4 main journal.
 - If crankshaft does **not** meet reuse guidelines:
 - Dealers should contact RAPIDSERVE™ Catastrophic group for pre-authorization if engine is under warranty.
 - Cummins® Distributors should follow their local catastrophic process or contact RAPIDSERVE™ for repair direction if engine is under warranty.
6. Repair fuel pump. Table 2 below **must** be referenced for specific instruction by product type. See Procedure 005-016 in Table 3 below.
7. Thoroughly clean lubricating oil cooler housing. See Procedure 007-003 in Table 3.
8. Replace following lubricating oil system components:
 - Lubricating oil cooler element. See Procedure 007-007 in Table 3.
 - Lubricating oil filter bypass valve. See Procedure 007-014 in Table 3.
 - Lubricating oil thermostat. See Procedure 007-039 in Table 3.
9. Install lubricating oil pan and other components removed to access main bearings. See procedure 007-025 in Table 3
10. Install a new lubricating oil filter. See Procedure 007-013 in Table 3.
11. Prime and fill the engine with new lubricating oil. See Procedure 007-037 in Table 3.
12. Perform an aftertreatment diesel particulate filter (DPF) regeneration. See Procedure 014-013 in Table 3.

13. Perform a second lubricating oil and lubricating oil filter change. Priming lubricating oil system a second time is **not** required. See Procedure 007-013 and 007-037 in Table 3.

Repair Direction B:

1. Repair the fuel pump. Table 2 below **must** be referenced for specific instruction by product type. See Procedure 005-016 in Table 3.
2. Drain the engine lubricating oil and remove the lubricating oil filter. See Procedure 007-013 and 007-037 in Table 3.
3. Replace the lubricating oil filter bypass valve. See Procedure 007-014 in Table 3.
4. Fit a new lubricating oil filter and refill the engine lubricating oil system. Priming the lubricating oil system is **not** required. See Procedure 007-013 and 007-037 in Table 3.

| Table 2, Fuel Pump Replacement Matrix | | |
|----------------------------------------------|-----------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Product | Fuel Pump Variation | Additional Action Needed When Replacing the Fuel Pump |
| ISX15 CM2250 | Two-cylinder pumps and fuel pump gear pump top mount fuel lines | There is a cost effective option to use a fuel pump short block service kit. Reference TSB150033. |
| ISX15 CM2250 SN | | |
| PowerGen QSX15 CM2250 | | |
| PowerGen QSX15 CM2250 ECF | Three cylinder, two piston fuel pumps | Reference TSB110064. |
| QSX15 CM2250 | Fuel pump gear pump with bottom mount fuel lines | New fuel lines are required. Reference TSB130044. |
| ISX15 CM2350 X101 | None | Reference TSB150033 for fuel pump repair options. If damage to fuel pump camshaft and roller tappets was identified during tappet inspection, fuel pump head must be reused, unless any of following conditions are present at time of repair: |
| QSX15 CM2350 X105 | | |

| Table 2, Fuel Pump Replacement Matrix | | |
|---------------------------------------|---------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Product | Fuel Pump Variation | Additional Action Needed When Replacing the Fuel Pump |
| QSX15 CM2350 X106 | | <ul style="list-style-type: none"> • Visual fuel leaks from Torx™ plugs on fuel pump head • Active or recently inactive fault codes related to fuel system performance (Example FC: 559, 4726, or 4727) • Complaints/confirmation of excessive fuel in lubricating oil. <p>Complete fuel pump assemblies should not be used for these repairs. If fuel pump head must be replaced, build a complete fuel pump using individual components.</p> |
| ISX12 CM2350 X102 | None | None |
| ISX12/ISX11.9 CM2250 | | |
| QSX11.9 CM2250 ECF | | |

| Table 3, Associated Procedures | | | |
|--------------------------------|--------------------------------------------------------------------------------------------|--------------------|-----------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Fuel Pump | Refer to Procedure 005-016 (/qs3/pubsys2/xml/en/procedures/132/132-005-016-tr-mixar5.html) | ISX15 CM2250 | 4022250 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Fuel Pump | Refer to Procedure 005-016 (/qs3/pubsys2/xml/en/procedures/175/175-005-016-tr.html) | ISX15 CM2250 SN | 4310736 |
| Fuel Pump | Refer to Procedure 005-016 (/qs3/pubsys2/xml/en/procedures/133/133-005-016-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |
| Fuel Pump | Refer to Procedure 005-016 (/qs3/pubsys2/xml/en/procedures/173/173-005-016-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Fuel Pump | Refer to Procedure 005-016 (/qs3/pubsys2/xml/en/procedures/132/132-005-016-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Fuel Pump | Refer to Procedure 005-016 (/qs3/pubsys2/xml/en/procedures/133/133-005-016-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Fuel Pump | Refer to Procedure 005-016 (/qs3/pubsys2/xml/en/procedures/250/250-005-016-tr.html) | QSX15 CM2350 X105 | 4332667 |
| Fuel Pump | Refer to Procedure 005-016 (/qs3/pubsys2/xml/en/procedures/221/221-005-016-tr.html) | QSX15 CM2350 X106 | 4332712 |
| Fuel Pump Head | Refer to Procedure 005-227 (/qs3/pubsys2/xml/en/procedures/132/132-005-227-tr-mixar5.html) | ISX15 CM2250 | 4022250 |
| Fuel Pump | Refer to Procedure 005-227 (/qs3/pubsys2/xml/en/procedures/175/175-005-227-tr.html) | ISX15 CM2250 SN | 4310736 |
| Fuel Pump Head | Refer to Procedure 005-227 (/qs3/pubsys2/xml/en/procedures/133/133-005-227-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Fuel Pump Head | Refer to Procedure 005-227 (/qs3/pubsys2/xml/en/procedures/173/173-005-227-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Fuel Pump Head | Refer to Procedure 005-227 (/qs3/pubsys2/xml/en/procedures/132/132-005-227-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Fuel Pump Head | Refer to Procedure 005-227 (/qs3/pubsys2/xml/en/procedures/133/133-005-227-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |
| Fuel Pump Head | Refer to Procedure 005-227 (/qs3/pubsys2/xml/en/procedures/250/250-005-227.html) | QSX15 CM2350 X105 | 4332667 |
| Fuel Pump Head | Refer to Procedure 005-227 (/qs3/pubsys2/xml/en/procedures/221/221-005-227.html) | QSX15 CM2350 X106 | 4332712 |
| Lubricating Oil Cooler | Refer to Procedure 007-003 (/qs3/pubsys2/xml/en/procedures/132/132-007-003-tr-mixar5.html) | ISX15 CM2250 | 4022250 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil Cooler | Refer to Procedure 007-003 (/qs3/pubsys2/xml/en/procedures/175/175-007-003-tr.html) | ISX15 CM2250 SN | 4310736 |
| Lubricating Oil Cooler | Refer to Procedure 007-003 (/qs3/pubsys2/xml/en/procedures/133/133-007-003-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |
| Lubricating Oil Cooler | Refer to Procedure 007-003 (/qs3/pubsys2/xml/en/procedures/173/173-007-003-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Lubricating Oil Cooler | Refer to Procedure 007-003 (/qs3/pubsys2/xml/en/procedures/132/132-007-003-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Lubricating Oil Cooler | Refer to Procedure 007-003 (/qs3/pubsys2/xml/en/procedures/133/133-007-003-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil Cooler | Refer to Procedure 007-003 (/qs3/pubsys2/xml/en/procedures/250/250-007-003-tr.html) | QSX15 CM2350 X105 | 4332667 |
| Lubricating Oil Cooler | Refer to Procedure 007-003 (/qs3/pubsys2/xml/en/procedures/221/221-007-003-tr.html) | QSX15 CM2350 X106 | 4332712 |
| Lubricating Oil Cooler Element | Refer to Procedure 007-007 (/qs3/pubsys2/xml/en/procedures/132/132-007-007-tr-mixar5.html) | ISX15 CM2250 | 4022250 |
| Lubricating Oil Cooler Element | Refer to Procedure 007-007 (/qs3/pubsys2/xml/en/procedures/175/175-007-007-tr.html) | ISX15 CM2250 SN | 4310736 |
| Lubricating Oil Cooler Element | Refer to Procedure 007-007 (/qs3/pubsys2/xml/en/procedures/133/133-007-007-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil Cooler Element | Refer to Procedure 007-007 (/qs3/pubsys2/xml/en/procedures/173/173-007-007-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Lubricating Oil Cooler Element | Refer to Procedure 007-007 (/qs3/pubsys2/xml/en/procedures/132/132-007-007-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Lubricating Oil Cooler Element | Refer to Procedure 007-007 (/qs3/pubsys2/xml/en/procedures/133/133-007-007-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |
| Lubricating Oil Cooler Element | Refer to Procedure 007-007 (/qs3/pubsys2/xml/en/procedures/250/250-007-007.html) | QSX15 CM2350 X105 | 4332667 |
| Lubricating Oil Cooler Element | Refer to Procedure 007-007 (/qs3/pubsys2/xml/en/procedures/221/221-007-007.html) | QSX15 CM2350 X106 | 4332712 |
| Lubricating Oil Filter (Spin-On) | Refer to Procedure 007-013 (/qs3/pubsys2/xml/en/procedures/132/132-007-013-tr-mixar5.html) | ISX15 CM2250 | 4022250 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil Filter (Spin-On) | Refer to Procedure 007-013 (/qs3/pubsys2/xml/en/procedures/175/175-007-013-tr.html) | ISX15 CM2250 SN | 4310736 |
| Lubricating Oil Filter (Spin-On) | Refer to Procedure 007-013 (/qs3/pubsys2/xml/en/procedures/133/133-007-013-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |
| Lubricating Oil Filter (Spin-On) | Refer to Procedure 007-013 (/qs3/pubsys2/xml/en/procedures/173/173-007-013-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Lubricating Oil Filter (Spin-On) | Refer to Procedure 007-013 (/qs3/pubsys2/xml/en/procedures/132/132-007-013-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Lubricating Oil Filter (Spin-On) | Refer to Procedure 007-013 (/qs3/pubsys2/xml/en/procedures/133/133-007-013-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil Filter (Spin-On) | Refer to Procedure 007-013 (/qs3/pubsys2/xml/en/procedures/250/250-007-013-tr.html) | QSX15 CM2350 X105 | 4332667 |
| Lubricating Oil Filter (Spin-On) | Refer to Procedure 007-013 (/qs3/pubsys2/xml/en/procedures/221/221-007-013-tr.html) | QSX15 CM2350 X106 | 4332712 |
| Lubricating Oil System | Refer to Procedure 007-037 (/qs3/pubsys2/xml/en/procedures/132/132-007-037-tr-mixar5.html) | ISX15 CM2250 | 4022250 |
| Lubricating Oil System | Refer to Procedure 007-037 (/qs3/pubsys2/xml/en/procedures/175/175-007-037-tr.html) | ISX15 CM2250 SN | 4310736 |
| Lubricating Oil System | Refer to Procedure 007-037 (/qs3/pubsys2/xml/en/procedures/133/133-007-037-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil System | Refer to Procedure 007-037 (/qs3/pubsys2/xml/en/procedures/173/173-007-037-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Lubricating Oil System | Refer to Procedure 007-037 (/qs3/pubsys2/xml/en/procedures/132/132-007-037-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Lubricating Oil System | Refer to Procedure 007-037 (/qs3/pubsys2/xml/en/procedures/133/133-007-037-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |
| Lubricating Oil System | Refer to Procedure 007-037 (/qs3/pubsys2/xml/en/procedures/250/250-007-037.html) | QSX15 CM2350 X105 | 4332667 |
| Lubricating Oil System | Refer to Procedure 007-037 (/qs3/pubsys2/xml/en/procedures/221/221-007-037.html) | QSX15 CM2350 X106 | 4332712 |
| Lubricating Oil Filter Bypass Valve | Refer to Procedure 007-014 (/qs3/pubsys2/xml/en/procedures/132/132-007-014-tr-mixar5.html) | ISX15 CM2250 | 4022250 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil Filter Bypass Valve | Refer to Procedure 007-014 (/qs3/pubsys2/xml/en/procedures/175/175-007-014-tr.html) | ISX15 CM2250 SN | 4310736 |
| Lubricating Oil Filter Bypass Valve | Refer to Procedure 007-014 (/qs3/pubsys2/xml/en/procedures/133/133-007-014-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |
| Lubricating Oil Filter Bypass Valve | Refer to Procedure 007-014 (/qs3/pubsys2/xml/en/procedures/173/173-007-014-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Lubricating Oil Filter Bypass Valve | Refer to Procedure 007-014 (/qs3/pubsys2/xml/en/procedures/132/132-007-014-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Lubricating Oil Filter Bypass Valve | Refer to Procedure 007-014 (/qs3/pubsys2/xml/en/procedures/133/133-007-014-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |
| Lubricating Oil Filter Bypass Valve | Refer to Procedure 007-014 (/qs3/pubsys2/xml/en/procedures/250/250-007-014.html) | QSX15 CM2350 X105 | 4332667 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil Filter Bypass Valve | Refer to Procedure 007-014 (/qs3/pubsys2/xml/en/procedures/221/221-007-014.html) | QSX15 CM2350 X106 | 4332712 |
| Lubricating Oil and Filter Analysis | Refer to Procedure 007-083 (/qs3/pubsys2/xml/en/procedures/132/132-007-083-tr-mixar5.html) | ISX15 CM2250 | 4022250 |
| Lubricating Oil and Filter Analysis | Refer to Procedure 007-083 (/qs3/pubsys2/xml/en/procedures/175/175-007-083-tr.html) | ISX15 CM2250 SN | 4310736 |
| Lubricating Oil and Filter Analysis | Refer to Procedure 007-083 (/qs3/pubsys2/xml/en/procedures/133/133-007-083.html) | ISX12/ISX11.9 CM2250 | 2883445 |
| Lubricating Oil and Filter Analysis | Refer to Procedure 007-083 (/qs3/pubsys2/xml/en/procedures/173/173-007-083-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Lubricating Oil and Filter Analysis | Refer to Procedure 007-083 (/qs3/pubsys2/xml/en/procedures/132/132-007-083-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil and Filter Analysis | Refer to Procedure 007-083 (/qs3/pubsys2/xml/en/procedures/133/133-007-083.html) | QSX11.9 CM2250 ECF | 2883561 |
| Lubricating Oil and Filter Analysis | Refer to Procedure 007-083 (/qs3/pubsys2/xml/en/procedures/250/250-007-083.html) | QSX15 CM2350 X105 | 4332667 |
| Lubricating Oil and Filter Analysis | Refer to Procedure 007-083 (/qs3/pubsys2/xml/en/procedures/221/221-007-083.html) | QSX15 CM2350 X106 | 4332712 |
| Lubricating Oil Thermostat | Refer to Procedure 007-039 (/qs3/pubsys2/xml/en/procedures/132/132-007-039-tr-mixar5.html) | ISX15 CM2250 | 4022250 |
| Lubricating Oil Thermostat | Refer to Procedure 007-039 (/qs3/pubsys2/xml/en/procedures/175/175-007-039-tr.html) | ISX15 CM2250 SN | 4310736 |
| Lubricating Oil Thermostat | Refer to Procedure 007-039 (/qs3/pubsys2/xml/en/procedures/133/133-007-039-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Lubricating Oil Thermostat | Refer to Procedure 007-039 (/qs3/pubsys2/xml/en/procedures/173/173-007-039-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Lubricating Oil Thermostat | Refer to Procedure 007-039 (/qs3/pubsys2/xml/en/procedures/132/132-007-039-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Lubricating Oil Thermostat | Refer to Procedure 007-039 (/qs3/pubsys2/xml/en/procedures/133/133-007-039-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |
| Lubricating Oil Thermostat | Refer to Procedure 007-039 (/qs3/pubsys2/xml/en/procedures/250/250-007-039.html) | QSX15 CM2350 X105 | 4332667 |
| Lubricating Oil Thermostat | Refer to Procedure 007-039 (/qs3/pubsys2/xml/en/procedures/221/221-007-039.html) | QSX15 CM2350 X106 | 4332712 |
| Aftertreatment Testing | Refer to Procedure 014-013 (/qs3/pubsys2/xml/en/procedures/101/101-014-013-tr-mixar5.html) | ISX15 CM2250 | 4022250 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Aftertreatment Testing | Refer to Procedure 014-013 (/qs3/pubsys2/xml/en/procedures/101/101-014-013-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |
| Aftertreatment Testing | Refer to Procedure 014-013 (/qs3/pubsys2/xml/en/procedures/101/101-014-013-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Aftertreatment Testing | Refer to Procedure 014-013 (/qs3/pubsys2/xml/en/procedures/101/101-014-013-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |
| Main Bearings | Refer to Procedure 001-006 (/qs3/pubsys2/xml/en/procedures/132/132-001-006-tr-mixar5.html) | ISX15 CM2250 | 4022250 |
| Main Bearings | Refer to Procedure 001-006 (/qs3/pubsys2/xml/en/procedures/175/175-001-006-tr.html) | ISX15 CM2250 SN | 4310736 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-----------------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Main Bearings | Refer to Procedure 001-006 (/qs3/pubsys2/xml/en/procedures/133/133-001-006-tr-mixab.html) | ISX12/ISX11.9 CM2250 | 2883445 |
| Main Bearings | Refer to Procedure 001-006 (/qs3/pubsys2/xml/en/procedures/173/173-001-006-tr-prix13.html) | ISX15 CM2350 X101 | 4310641 |
| Main Bearings | Refer to Procedure 001-006 (/qs3/pubsys2/xml/en/procedures/132/132-001-006-tr-vqxi6.html) | QSX15 CM2250 ECF | 2883557 |
| Main Bearings | Refer to Procedure 001-006 (/qs3/pubsys2/xml/en/procedures/133/133-001-006-tr-vqxb.html) | QSX11.9 CM2250 ECF | 2883561 |
| Main Bearings | Refer to Procedure 001-006 (/qs3/pubsys2/xml/en/procedures/250/250-001-006-tr.html) | QSX15 CM2350 X105 | 4332667 |

| Table 3, Associated Procedures | | | |
|---------------------------------------|-------------------------------------------------------------------------------------|---------------------------|------------------------|
| Procedure Title | Procedure Number | Service Model Name | Bulletin Number |
| Main Bearings | Refer to Procedure 001-006 (/qs3/pubsys2/xml/en/procedures/221/221-001-006-tr.html) | QSX15 CM2350 X106 | 4332712 |

Document History

| Date | Details |
|-------------|-------------------------------------------------------------------------------------------|
| 2014-2-14 | Module Created |
| 2014-9-4 | none |
| 2014-10-24 | Fixed broken link. |
| 2014-10-29 | Typo corrected. |
| 2015-1-7 | Procedure steps updated. |
| 2015-3-17 | Added the fuel pump short block service kit TSB reference. |
| 2015-10-19 | Modified the fuel pump tappet rollers are damaged section step 1 and options a, b, and c. |
| 2016-4-5 | Modified title. Added Product Affected section. Updated repair direction and Table 3. |
| 2016-7-5 | Removed "Ceramic" from title. Modified Table 2. |
| 2016-12-6 | Repair Direction A: moved Steps 1, 3, and 4 to step numbers 6, 7, and 8. |
| 2017-1-10 | Updated Table 3, Associated Procedures. |
| 2017-4-10 | Updated repair direction. |
| 2017-11-10 | Non-Product Problem Solving (PPS) |

Last Modified: 17-Nov-2017
