



# Technical Service Bulletin

---

## 01 MIL on (DTC P030500) stored in ECM

01 17 33 2045909/4 August 18, 2017. Supersedes Technical Service Bulletin Group 01 number 17-14 dated May 9, 2017 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
RS 7, RS 7 performance, and S8 +	2016 - 2017	All	Not Applicable

## Condition

REVISION HISTORY		
Revision	Date	Purpose
4	-	Revised header data (Corrected display)
3	05/09/2017	Revised header data (Corrected display)
2	01/19/2017	Revised header data (Added model) Revised title (Updated formatting)

### Customer statement:

- MIL on or flashing.

### Workshop findings:

Only DTCs regarding misfiring on cylinder 5 (P030500) are logged in the engine control module (ECM), J623 (address word 0001).

The following values are logged in the specific ambient conditions for DTC P030500:

- Engine speed between 5500 and 5900 rpm
- Standard load value over 70%
- Engine torque over 750 Nm

## Technical Background

OBD diagnostics too sensitive at high engine load conditions.



# Technical Service Bulletin

## Production Solution

New software in the engine control module (ECM), (J623) (address word 0001) addressed the condition.

## Service

### SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the engine control module (ECM), J623 (address word 0001) using the SVM action code as listed in the table below if necessary:

Model	Engine Code	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
RS 7	CWUB	4G0906560G	0001	4G0906560G	0002	01A225
RS 7 performance	CWUC	4G0906560G	0001	4G0906560G	0002	01A225
S8 plus	DDTA	4H0907557H	0001	4H0907557H	0002	01A225

## Warranty

<b>Claim Type:</b>	<ul style="list-style-type: none"><li>• 110 up to 48 Months/50,000 Miles.</li><li>• 1E1 up to 8 Years/80,000 Miles.</li><li>• G10 for CPO Covered Vehicles – Verify Owner.</li><li>• If vehicle is outside any warranty, this Technical Service Bulletin is informational only.</li></ul>		
<b>Service Number:</b>	2470		
<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Update ECM software level	2470 2599	Max 50 TU
<b>Diagnostic Time:</b>	GFF – Checking and clearing fault codes included in existing labor operations	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU



# Technical Service Bulletin

---

	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
<b>Claim Comment:</b>	As per TSB #2045909/4		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Required Parts and Tools

Approved battery charger.

## Additional Information

The following Technical Service Bulletin(s) will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All parts and service references provided in this TSB (2045909) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

©2017 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites without the prior expressed written permission of the publisher.