



NUMBER: 23-011-13

GROUP: Body

DATE: February 27, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 13-012. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN'S HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

SUBJECT:

Passenger Compartment Odor

OVERVIEW:

This bulletin involves replacing all door weatherstrip seals and decklid seals on select models.

MODELS:

2013	(LC)	Challenger
2013	(LD)	Charger
2013	(LX)	300

NOTE: This applies to vehicles built after November 26, 2012 (MDH1126XX) and before November 30, 2012 (MDH1130XX).

SYMPTOM/CONDITION:

The door weatherstrip seals on all models and decklid weatherstrip seals on 300's and Chargers have been contaminated during part processing and it will create an odor in the passenger compartment.

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair. For all other customers that describe the symptom/condition, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1 (AR)	68067557AB	Weatherstrip, Left Front Door Mounted (Challenger Only)
1 (AR)	68067556AB	Weatherstrip, Right Front Door Mounted

Qty.	Part No.	Description
		(Challenger Only)
1 (AR)	68040045AH	Weatherstrip, Left Front Door Mounted (Charger Only)
1 (AR)	68040044AH	Weatherstrip, Right Front Door Mounted (Charger Only)
1 (AR)	68040046AK	Weatherstrip, Right Rear Door Mounted (Charger Only)
1 (AR)	68040047AK	Weatherstrip, Left Rear Door Mounted (Charger Only)
1 (AR)	68042856AA	Weatherstrip, Right Rear Wheelhouse Mounted (Charger Only)
1 (AR)	68042857AA	Weatherstrip, Left Rear Wheelhouse Mounted (Charger Only)
1 (AR)	68040038AC	Run, Right Front Door Glass (Charger Only)
1 (AR)	68040039AC	Run, Left Front Door Glass (Charger Only)
1 (AR)	68040034AC	Weatherstrip, Right Front Door Belt, Inner (Charger Only)
1 (AR)	68040035AC	Weatherstrip, Left Front Door Belt, Inner (Charger Only)
1 (AR)	68040036AC	Weatherstrip, Right Rear Door Belt, Inner (Charger Only)
1 (AR)	68040037AC	Weatherstrip, Left Rear Door Belt, Inner (Charger Only)
1 (AR)	68040060AG	Weatherstrip, Decklid (Charger Only)
1 (AR)	68039974AF	Weatherstrip, Right Front Door Mounted (300 Only)
1 (AR)	68039975AF	Weatherstrip, Left Front Door Mounted (300 Only)
1 (AR)	68039976AG	Weatherstrip, Right Rear Door Mounted (300 Only)
1 (AR)	68039977AG	Weatherstrip, Left Rear Door Mounted (300 Only)
1 (AR)	68039966AD	Run, Right Front Door Glass (300 Only)
1 (AR)	68039967AD	Run, Left Front Door Glass (300 Only)
1 (AR)	68039964AC	Weatherstrip, Right Front Door Belt, Inner (300 Only)
1 (AR)	68039965AC	Weatherstrip, Left Front Door Belt, Inner (300 Only)
1 (AR)	68039970AC	Weatherstrip, Door Belt Inner, Right Rear Door (300 Only)

Qty.	Part No.	Description
1 (AR)	68039971AC	Weatherstrip, Door Belt Inner, Left Rear Door (300 Only)
1 (AR)	68040030AD	Weatherstrip, Decklid (300 Only)

REPAIR PROCEDURE:

1. Remove and replace the door weatherstrip seals on all models and the decklid weatherstrip seals on 300's and Chargers only.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
23-51-10-9A	Replace All Door Weatherstrip Seals (Challengers Only) (1 - Semi-Skilled)	0.4 Hrs.
23-51-10-9B	Replace All Door And Decklid Weatherstrip Seals (Charger Only) (1 - Semi-Skilled)	2.2 Hrs.
23-51-10-9C	Replace All Door And Decklid Weatherstrip Seals (300 Only) (1 - Semi-Skilled)	2.1 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------