

[Traduire](#)

Roadster SE5 Engine Noise - Left Hand Side - Possible Cause

[Printable Version](#)

Rate This Article

(Average Rating: No Rating)

[Version 1](#)[Language](#) English[Show Properties](#)**Summary:**

On some SE5 engines a high pitched or whining noise may be heard under specific RPM only (only at 3500rpm for example).

Type:

General

TST Detail:

After investigation the cause of this noise is from a thrust washer vibrating and spinning in the HCM.

Inspect the HCM housing for wear; it may need to be replaced.

If the HCM housing doesn't present any signs of wear, replace:

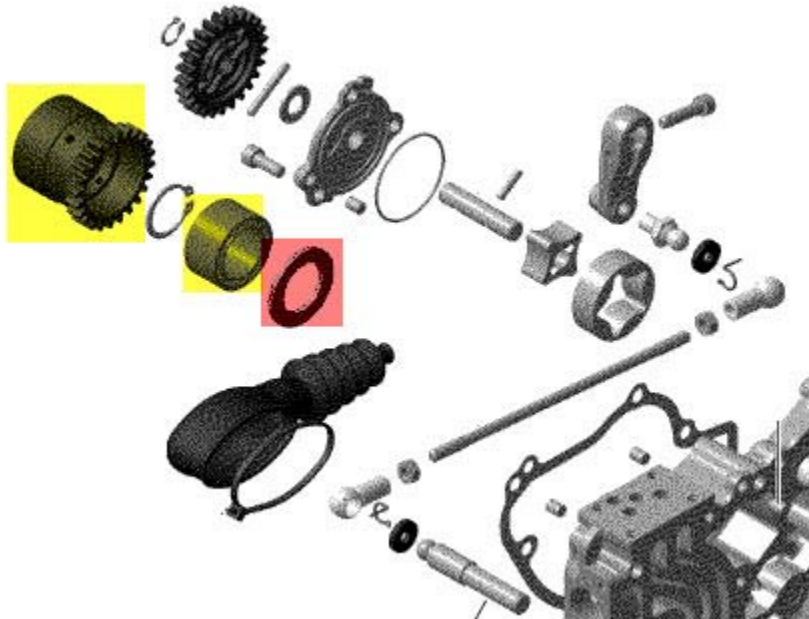
Thrust washer 420227391

Needle bearing 420632640

Oil pump gear, 24 tooth 420434601

and other associated parts.....gaskets..... as needed.

HCM housing 420611493

**Attachment:**

First Published By: Dany Davey on 2013-10-25

Last Modified By: Dany Davey on 2013-10-25