



Preliminary Information

PIP5553 SES Lamp With Camshaft or Oil Pump System Related DTCs

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CTS-V	2018	All	All	6.2L, LT1, LT4	All
Cadillac	Escalade	2018	All	All	6.2L, L86	All
Chevrolet	Camaro	2018	All	All	6.2L, LT1, LT4	All
Chevrolet	Corvette	2018	All	All	6.2L, LT1, LT4	All
Chevrolet	Silverado	2018	All	All	4.3L 5.3L 6.2L LV3, L83, L86	All
Chevrolet	Suburban	2018	All	All	5.3L L83 6.2L, L86	All
Chevrolet	Tahoe	2018	All	All	5.3L L83 6.2L L86	All
GMC	Sierra	2018	All	All	4.3L 5.3L 6.2L LV3, L83, L86	All
GMC	Yukon Models	2018	All	All	5.3L, 6.2L, L83, L86	All

 
 
Involved Region or Country	North America
Condition	The vehicle may have an SES lamp with any of the following DTC P06DA, P06DB, P06DC, P06B6, P06B7, P250A, P0300, P0340, P0341, P0335, P0336, P0641, P0011, P0010, P2088, P2089, and/or P2230. Possible crank no start or a stall.
Cause	Possible wiring jumper harness chaffed at the bolt at the X154 connector on lower left side of the engine front cover.

Correction:

Inspect for the wiring harness being chaffed or pinched under the bracket on the location below.



Below is what has been found



**Before installing a new jumper harness be sure to inspect the wiring harness.
As seen above 1. shows a good harness 2. shows a suspect harness.
if the harness looks like number 2 please adjust the harness as needed.**

When a permanent repair or part replacement is identified a PI revision or bulletin will be submitted.

Version History

Version	1
Modified	



© 2016 General Motors. All Rights Reserved.