1301 STAHLEY DRIVE BUILDING #42 NAPPANEE, IN 46550

NEWMAR CORPORATION WARRANTY DEPARTMENT

| Dealer | Svc. | 866-290-5371 |
|----------|------|--------------|
| Customer | Svc | 800-731-8300 |

TECHNICAL SERVICE BULLETIN MODEL YEAR(S) AFFECTED **DATE ISSUED** TSB# 2/1/2018 2018 510 **MODEL** $|\mathbf{x}|$ Essex П Bay Star Sport \boxtimes Ventana King Aire Bay Star $|\mathbf{X}|$ **Dutch Star** Canyon Star |X|Mountain Aire New Aire П Ventana LE X London Aire Other DESCRIPTION

Newmar has determined that certain coaches may have had a substitute water pump installed during the manufacturing process.

Issue: The substitution pump requires a 15 amp fuse in lieu of the 10 amp fuse that was installed. This does not pose a safety issue, but the user may overload the 10 amp fuse during pump operation.

Correction: Inspect the water pump to see if it states "Fuse: 15A required." If it does, proceed by installing a 15 amp fuse for the water pump and changing the water pump fuse label from 10A to 15A.

Affected Units: See attached population list

RECOMMENDED ACTION

Inspect the water pump to see if it states "Fuse: 15A required." If it does, proceed by installing a 15 amp fuse for the water pump and labeling the fuse panel accordingly. If the pump does not state "Fuse: 15A required" no action is needed. Order fuse and label from the Newmar Parts Department when fuse and label change is necessary.

Note: The wiring is sufficient for the new 15 amp fuse.

15 Amp Fuse Part # 22238 15A label

Flat Rate: TSB 510 Labor Time: .2

Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.