

Subject PBD System Replacement Part Identification Method		Market USA
Service Category Vehicle Exterior	Section Door/Hatch	
Applicability 2008-2013 Highlander/HV		

APPLICABLE VEHICLES

2008-2013	Highlander	2008-2013	Highlander HV
-----------	------------	-----------	---------------

















CONDITION

When replacing components on vehicles equipped with the Power Back Door option, please reference the following guide to ensure the correct parts are used in combination with each other.

RECOMMENDATIONS

Please use the documents below to ensure the correct service parts are used in combination with each other.

- If T-SB-0191-17--Warranty Enhancement Program ZG4 was performed, please use the following form:

Please ensure the correct parts are used in each application			
	Vehicles Equipped With JBL 9-Speaker Audio		Vehicle Equipped Without JBL 9-Speaker Audio
Panel Sub-Assy Back Door	  <p>67005-48860</p> <p>Identification Method: 18mm stamping hole</p>		  <p>67005-48860</p> <p>Identification Method: 18mm stamping hole</p>
Stay Assy Back Door	    <p>LH : 68960-48260 RH : 68950-48260</p> <p>Identification Method: LH:LK RH:RK</p>		    <p>LH : 68960-48170 RH : 68950-48220</p> <p>Identification Method: LH:L RH:R</p>
Motor Unit, Back Door	  <p>85007-0E030 or 85007-48020</p> <p>Identification Method: Blue Paint Dot on Motor Arm</p>		  <p>85007-0E030 or 85007-48020</p> <p>Identification Method: Blue Paint Dot on Motor Arm</p>

****Important****

Please Read prior to install

Subject

PBD System Replacement Part Identification Method

Market



USA

Applicability

RECOMMENDATIONS

- If T-SB-0191-17--Warranty Enhancement Program ZG4 has **NOT** been performed, please use the following form:

Please ensure the correct parts are used in each application

	Vehicles Equipped With JBL 9-Speaker Audio		Vehicle Equipped Without JBL 9-Speaker Audio
Panel Sub-Assy Back Door	 <p>67005-0E232</p> <p>Identification Method: Confirm no markings are present</p>		 <p>67005-0E232</p> <p>Identification Method: Confirm no markings are present</p>
Stay Assy Back Door	 <p>LH: 68960-0E071 RH: 68950-0E071</p> <p>Identification Method: LH:LG RH:RG</p>		 <p>LH: 68960-0E061 RH: 68950-0E061</p> <p>Identification Method: LH:LF RH:RF</p>
Motor Unit, Back Door	 <p>85007-09003</p> <p>Identification Method: NO blue dot present</p>		 <p>85007-09003</p> <p>Identification Method: NO blue dot present</p>

****Important****
Please Read prior to install

LINK REFERENCES

- [T-SB-0191-17: '08-'13 Highlander/HV: Power Back Door System Has Abnormal Closing Operation](#)