

# **HID Headlamp Housing Paint Bubble / Poor Appearance**

Service

Category Vehicle Exterior

Section Lighting (ext) Market USA



### **Applicability**

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2011 – 2013	IS F, IS250, IS250C, IS350, IS350C	

#### **REVISION NOTICE**

September ##, 2013 Rev1:

- . Applicability has been updated to include additional 2013 model year Lexus vehicles.
- The Production Change Information, Warranty Information, Parts Information, and Repair Procedure sections have been updated.

Any previous printed versions of this bulletin should be discarded.

#### Introduction

Some 2011 – 2013 model year IS 250/350/250C/350C and IS F vehicles equipped with HID (High Intensity Discharge) headlights may exhibit a paint bubbling/wrinkling condition on top of the LED strip within one or both of the headlight housings. Newly designed headlight units have been developed to address this condition. Follow the procedure in this bulletin to install the updated headlight units.

#### **Production Change Information**

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	ENGINE	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN	
	Tahara	40D 505	2WD	JTHBF5C2#C5160946	
10.050			4WD	JTHCF5C2#C5054034	
15 250			4GR-FSE	2WD	JTHBF5C2#C2102829
	TMK		4WD	JTHCF5C2#C2035980	
10.050 Tabasa		050 Tabasa 00D 505	2WD	JTHBE5C2#C5029025	
IS 350 Tahara	Tahara 2GR-FSE -	4WD	JTHCE5C2#C5002374		

Rev1

Page 2 of 6

## **HID Headlamp Housing Paint Bubble / Poor Appearance**

#### **Production Change Information (Continued)**

MODEL	PLANT	ENGINE	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN	
IS 250C	TMK	4GR-FSE		JTHFF2C2#D2528759	
IS 350C	IIVIN	2GR-FSE	2WD	JTHFE2C2#D2509743	
IS F	Tahara	2UR-GSE		JTHBP5C2#D5011225	

#### **Warranty Information**

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
BD9097	R & R Headlight Units, Transfer Components, & Aim Headlights	2.6	81145-53540 81145-53541 81145-53542 81145-53543 81185-53540 81185-53541 81185-53542 81185-53543 81145-53670 81145-53671 81145-53673 81145-53673 81185-53670 81185-53671 81185-53673	99	15

#### **APPLICABLE WARRANTY**

- . This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.



## **HID Headlamp Housing Paint Bubble / Poor Appearance**

#### **Parts Information**

#### **NOTE**

- If the headlight assembly does not have visible paint bubbles and only one headlight needs to be replaced (for collision damage repairs, etc.), use the part number for the headlight that the vehicle is currently equipped with. Updated parts are not compatible with prior part numbers.
- If either headlight assembly has visible paint bubbles, replace the headlights in pairs with the NEW part numbers.

MODEL	PART	NUMBER	PART NAME	QTY
MODEL	PREVIOUS	NEW	PART NAME	
	81145-53540			1
	81145-53541	]		
	81145-53542	81145-53544	Unit, Headlamp, RH	
IS 250/350	81145-53543	1		
10 230/330	81185-53540			
	81185-53541	04405 50544	Unit, Headlamp, LH	1
	81185-53542	81185-53544		
	81185-53543	1		
	81145-53670	81145-53674		1
	81145-53671		Unit, Headlamp, RH	
	81145-53672			
	81145-53673			
10.0500/0500	81145-53543	81145-53544		
IS 250C/350C	81185-53670			
	81185-53671	04405 50074		1
	81185-53672	81185-53674	Unit, Headlamp, LH	
	81185-53673			
	81185-53543	81185-53544		

Page 4 of 6



## **HID Headlamp Housing Paint Bubble / Poor Appearance**

### **Parts Information (Continued)**

MODEL	PART I	NUMBER	PART NAME	QTY
MODEL	PREVIOUS	NEW		
	81145-53670			
	81145-53671	81145-53674	Unit, Headlamp, RH	1
10. F	81145-53672			
	81145-53673			
IS F	81185-53670	81185-53674 Unit, Headlamp, LH	llait llagdiones III	
	81185-53671			1
	81185-53672		Uniii, neadiamp, Ln	ı
	81185-53673			

### **Required Tools & Equipment**

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Plastic Pry Tool Set*	00002-06020-02	1

<sup>\*</sup> Essential SST.

### **NOTE**

Additional SSTs may be ordered by calling 1-800-933-8335.


REQUIRED MATERIAL	QUANTITY
Protective Tape	As Needed



## **HID Headlamp Housing Paint Bubble / Poor Appearance**

#### **Repair Procedure**

Confirm vehicle has the headlight housing paint bubble condition (see Figure 1 for an example).
If a poor appearance is found, continue to step 2. If not, this bulletin does NOT apply.
Figure 1.

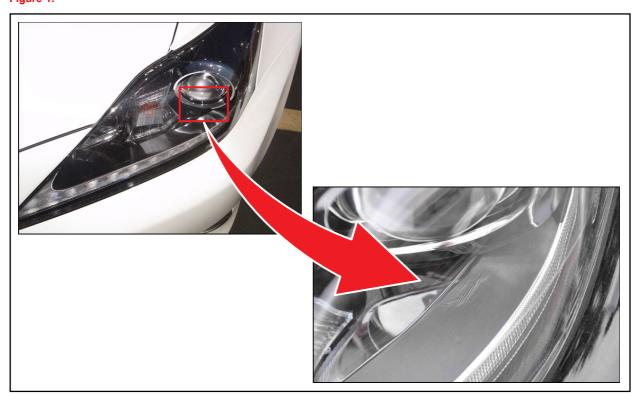

- 2. Replace both headlight units.
  - A. Remove both headlights.

Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:

Vehicle Exterior – Lighting (ext) – "Lighting: Headlight Assembly: Removal"

- <u>2011</u> / <u>2012</u> / <u>2013</u> IS 250/350
- 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F

Rev1



## **HID Headlamp Housing Paint Bubble / Poor Appearance**

#### **Repair Procedure (Continued)**

B. Disassemble the headlight assemblies.

Refer to TIS, applicable model and model year Repair Manual: Vehicle Exterior – Lighting (ext) – "Lighting (ext): Headlight Assembly: Disassembly"

- 2011 / 2012 / 2013 IS 250/350
- 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F
- C. Reassemble the headlight assemblies using the new headlight units.

Refer to TIS, applicable model and model year Repair Manual: Vehicle Exterior – Lighting (ext) – "Lighting: Headlight Assembly: Reassembly"

- 2011 / 2012 / 2013 IS 250/350
- 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F
- D. Install the completed headlight assemblies with the new headlight units.

Refer to TIS, applicable model and model year Repair Manual: Vehicle Exterior – Lighting (ext) – "Lighting: Headlight Assembly: Installation"

- 2011 / 2012 / 2013 IS 250/350
- 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F
- E. Adjust the headlight assemblies.

Refer to TIS, applicable model and model year Repair Manual: Vehicle Exterior – Lighting (ext) – "Lighting (ext): Headlight Assembly: Adjustment"

- 2011 / 2012 / 2013 IS 250/350
- 2011 / 2012 / 2013 IS 250C/350C
- 2011 / 2012 / 2013 IS F
- 3. Confirm headlight operation.