

Repair Manual Supplement: SRS DTCs Not Listed in Repair Manual

Service Category Vehicle Interior

Section Supplemental Restraint Systems

Market USA

Toyota Supports ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2012	Corolla, Prius, Prius V, Sienna, Venza	

Introduction

Some 2012 model year Corolla, Prius, Prius V, Sienna, and Venza vehicles may set SRS Diagnostic Trouble Codes (DTCs) that are not listed in the Repair Manual. Refer to the chart in this bulletin to diagnose these DTCs.

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
N/A	Not Applicable to Warranty	–	–	–	–

Required Tools & Equipment

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY
Techstream 2.0*	ADE	TS2UNIT	1
TIS Techstream		TSPKG1	
Techstream Lite		TSLITEDLR01	

* Essential SST.

NOTE

- Only ONE of the Techstream units listed above is required.
- Software version 8.00.034 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

Repair Manual Supplement: SRS DTCs Not Listed in Repair Manual

SRS DTC Cross Reference List

If an SRS DTC set is not listed in the Repair Manual, refer to the chart below. Follow the diagnostic procedures listed in the Repair Manual for the corresponding Repair Manual DTC.

MODEL	SET DTC	DETECTION ITEM	REPAIR MANUAL DTC
Corolla	B1603	Front Satellite Sensor Bus RH Initialization Incomplete	<u>B1610</u>
	B1608	Front Satellite Sensor Bus LH Initialization Incomplete	<u>B1615</u>
	B1612	Lost Communication with Front Airbag Sensor RH	<u>B1610</u>
	B1613	Front Airbag Sensor RH Initialization Incomplete	<u>B1610</u>
	B1617	Lost Communication with Front Airbag Sensor LH	<u>B1615</u>
	B1618	Front Airbag Sensor LH Initialization Incomplete	<u>B1615</u>
	B1623	Side Airbag Sensor RH Initialization Incomplete	<u>B1620</u>
	B1628	Side Airbag Sensor LH Initialization Incomplete	<u>B1625</u>
	B1632	Lost Communication with No. 2 Side Airbag Sensor RH	<u>B1630</u>
	B1633	No. 2 Side Airbag Sensor RH Initialization Incomplete	<u>B1630</u>
	B1637	Lost Communication with No. 2 Side Airbag Sensor LH	<u>B1635</u>
	B1638	No. 2 Side Airbag Sensor LH Initialization Incomplete	<u>B1635</u>
	B1642	Lost Communication with Side Satellite Sensor Bus RH	<u>B1630</u>
	B1643	Side Satellite Sensor Bus RH Initialization Incomplete	<u>B1630</u>
	B1647	Lost Communication with Side Satellite Sensor Bus LH	<u>B1635</u>
	B1648	Side Satellite Sensor Bus LH Initialization Incomplete	<u>B1635</u>
B1656	Seat Belt Buckle Switch LH Circuit	<u>B1771*</u>	
Prius	B1603	Front Satellite Sensor Bus RH Initialization Incomplete	<u>B1610</u>
			<u>B1615</u>
Prius V	B1608	Front Satellite Sensor Bus LH Initialization Incomplete	<u>B1610</u>
			<u>B1615</u>
Sienna	* B1603	Front Satellite Sensor Bus RH Initialization Incomplete	<u>B1610</u>
	B1608	Front Satellite Sensor Bus LH Initialization Incomplete	<u>B1615</u>
	B1643	Side Satellite Sensor Bus RH Initialization Incomplete	<u>B1630</u>
	B1648	Side Satellite Sensor Bus LH Initialization Incomplete	<u>B1635</u>
Venza	B1603	Front Satellite Sensor Bus RH Initialization Incomplete	<u>B1610</u>
	B1608	Front Satellite Sensor Bus LH Initialization Incomplete	<u>B1615</u>
	B1643	Side Satellite Sensor Bus RH Initialization Incomplete	<u>B1630</u>
	B1648	Side Satellite Sensor Bus LH Initialization Incomplete	<u>B1635</u>

* Refer to B1771 of Occupant Classification System.