


# Back-up Camera Transition

**Service Category** Audio/Visual/Telematics

**Section** Park Assist/Monitoring

**Market** USA

Lexus Supports  
ASE Certification 

## Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2013	ES300H, ES350, RX350, RX450H	

## Introduction

Some 2013 model year ES 300h/350 and RX 350/450h vehicles equipped with Lexus Display Audio (non-navigation) may experience a transition delay on the display screen when shifting the vehicle from "R" to "D" and while an object is being detected in the corner sensor. If this condition exists, replacement of the audio head unit is necessary to address this condition.

## Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN
ES 300h/350	TMK	2WD	JTHBW1GG#D2014038
			JTHBK1GG#D2035127
RX 350/450h	TMK Line 1	AWD	JTJZK1BA#D2007595
	TMK Line 2		JTJZK1BA#D2417133
	TMMC	2WD	2T2ZK1BA#DC108725
		AWD	2T2BK1BA#DC187221
	TMK Line 1	2WD	JTJBK1BA#D2027287
			JTJZB1BA#D2008073
		AWD	JTJBC1BA#D2059667
	TMK Line 2	2WD	JTJBK1BA#D2456858
			JTJZB1BA#D2411554
			JTJBC1BA#D2446313

## Back-up Camera Transition

### Warranty Information

OP CODE	DESCRIPTION	MODEL	TIME	OFP	T1	T2
860031	R & R Radio Assembly	ES 300h/350	0.5	86140-33060	87	74
		RX 350/450h (TMK)	0.6	86140-48010		
		RX 350 (TMMC)		86140-0E010		

#### APPLICABLE WARRANTY

- This repair is covered under the Lexus Basic Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

#### NOTE

Please order a replacement radio through the applicable radio exchange program per the Lexus Warranty Policy and Procedures, "[Policy 4.13: Audio Systems Warranty](#)".

### Parts Information

MODEL	PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
ES 300h/350	86140-33060	Same	Receiver Assy, Radio	1
RX 350/450h (TMK)	86140-48010			
RX 350 (TMMC)	86140-0E010			

### Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
Plastic Pry Tool Set*	<a href="#">00002-06000-01</a>	1

\* Essential SST.

#### NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

## Back-up Camera Transition

---

### Repair Procedure

1. Confirm the condition described in the introduction exists.
2. Replace the radio assembly.

Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:

- 2013 ES 300h:  
*Audio / Visual / Telematics – Audio / Video – “Audio / Video: Radio Receiver: [Removal](#) / [Installation](#)”*
  - 2013 ES 350:  
*Audio / Visual / Telematics – Audio / Video – “Audio / Video: Radio Receiver: [Removal](#) / [Installation](#)”*
  - 2013 RX 350:  
*Audio / Visual / Telematics – Audio / Video – “Audio / Video: Radio Receiver: [Removal \(03/2012 - 07/2012\)](#) / [Removal \(07/2012 - \)](#) / [Installation \(03/2012 - 07/2012\)](#) / [Installation \(07/2012 - \)](#)”*
  - 2013 RX 450h:  
*Audio / Visual / Telematics – Audio / Video – “Audio / Video: Radio Receiver: [Removal](#) / [Installation](#)”*
3. Verify the system operates normally, and the condition is no longer present.