



Service Bulletin

File in Section: -

Bulletin No.: 16-NA-151

Date: May, 2016

TECHNICAL

Subject: Traction Control System Light On With DTC C0460 Set

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Malibu (VIN Z)	2016	2016			All	All

Involved Region or Country	North America and Israel
Condition	Some customers may comment that the Traction Control System (Stabilitrak) light is On. During diagnosis a technician may find that DTC C0460 is set within the electronic brake control module.
Cause	This may be caused by a brief low voltage incident.

Correction

If you encounter a vehicle with the above concern, complete the following steps:

Important: Do not replace any parts for this condition.

1. Once the concern is verified and with the ignition ON, turn the steering wheel from full lock to lock and back again in order to reset the steering angle sensor.
2. Once this turning sequence is completed, clear the DTC and verify it does not reset.
If DTC does reset, refer to SI for further diagnosis.

Warranty Information

Labor Operation	Description	Labor Time
7480238*	Reset the Steering Angle Sensor	0.3 hr
*This is a unique Labor Operation for Bulletin use only.		

Version	1
Modified	

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION