

OM651 Exhaust Bracket Cracking

Topic number	LI49.10-N-060969
Version	2
Design group	49.10 Exhaust pipes, catalytic converter, mufflers
Date	05-12-2016
Validity	Sprinter Model 906 with engine OM651
Reason for change	Part number change
Reason for block	

Complaint:

Rattling noise from under vehicle

Cause:

Exhaust bracket cracking (Pic 3)

Attachments	
File	Description
Pic 3.jpg	Broken DPF bracket

Remedy:

Inspect and replace exhaust bracket (Pic 1 & 3) as needed with current part number (check EPC for latest part number). Inspect bell housing for damage replace as needed. There is a new redesign exhaust bracket in preparation at the supplier. When the new part is available this LI will be updated to inform you of the new part number.

Attachments	
File	Description
Pic 1.jpg	Mounting position of the DPF bracket
Pic 2.jpg	Mounting position of the DPF bracket - Transmission

Symptoms

Power generation / Exhaust system / Noises / Rattling

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 906 492 14 00			Exhaust bracket 4x2	1	New DPF Bracket	X
A 906 492 15 00			Exhaust Bracket 4x4	1	New DPF Bracket	X

Operation numbers/damage codes

XENTRY TIPS


Op. no.	Operation text	Time	Damage code	Note
49-6960	REPLACE BRACKET		4901H 38	

Attachments

Pic 1.jpg:



Pic 2.jpg:

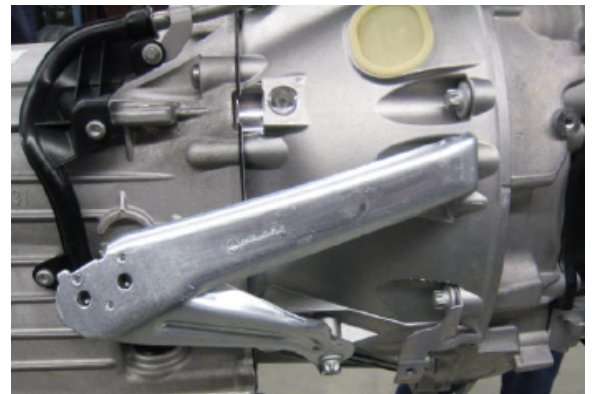

Pic 3.jpg:

