

XENTRY TIPS

Model series 166 chafe mark on wiring harness - Bracket in center console is sharp-edged

Topic number	LI68.20-P-063996
Version	1
Design group	68.20 Center console
Date	04-29-2016
Validity	Model series 166
Reason for change	
Reason for block	

Complaint:

- Empty or weak battery
- Rear blower motor (booster blower) nonfunctional
- Rear air flap nonfunctional

Cause:

Wiring harness on booster blower or rear air flap may contact the metal bracket for the center console and suffer chafing (Pic. 1)

Attachments	
File	Description
Pic 1.jpg	Area of damage

Remedy:

Attach felt 170 x 15 x 1 mm along entire length of front edge for center console bracket (Pic. 2).

Attachments	
File	Description
Pic 2.jpg	Position felt on bracket


Symptoms
Overall vehicle / Wiring / Cable damaged/faulty
Overall vehicle / Power supply / Battery/On-board electrical system / Battery function / Battery discharges
Body / Air conditioning / Heater / Insufficient sensitivity in blower control

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 983 71 10			Felt	1		X

XENTRY TIPS

Attachments

Pic 1.jpg:

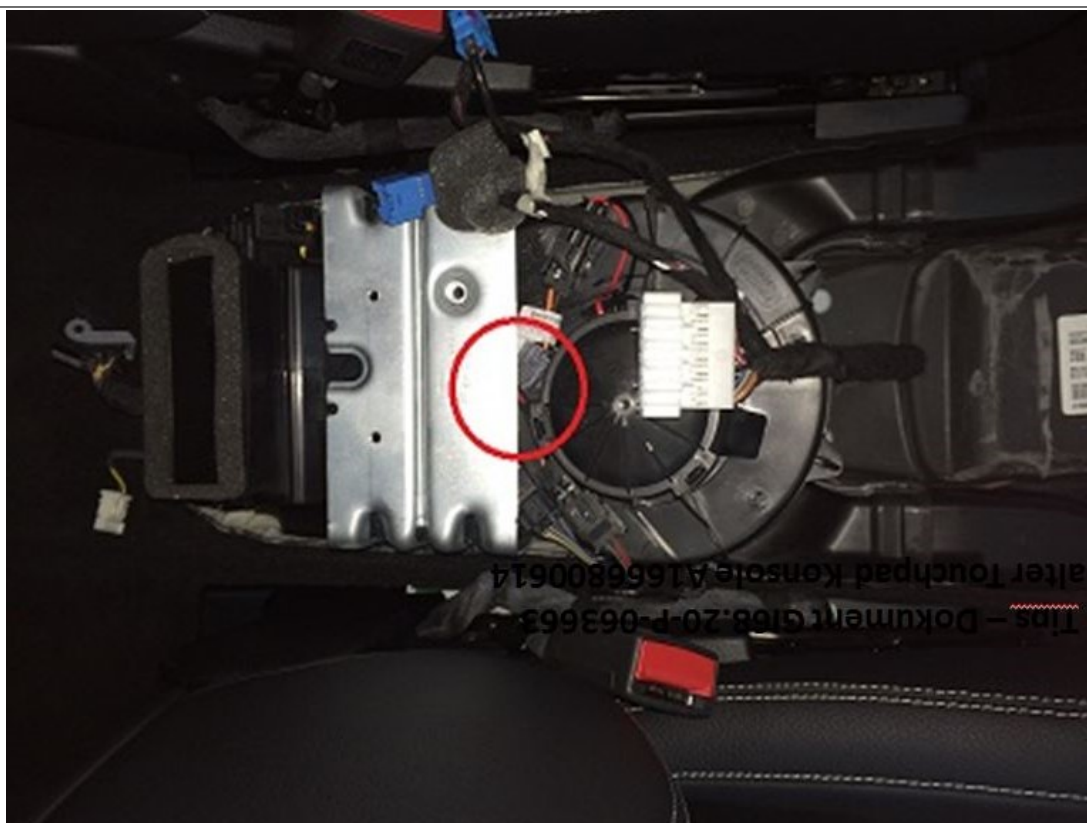

Pic 2.jpg:

