

## Variable rear spoiler occasionally fails to extend or retract.

Topic number	LI77.25-P-063997
Version	1
Design group	77.25 Wind deflector (spoiler)
Date	04-29-2016
Validity	MODEL 190.###
Reason for change	
Reason for block	

### Complaint:

Variable rear spoiler occasionally fails to extend or retract.

### Cause:

Faulty contact on relay.

Attachments	
File	Description
Position_Relais.jpg	Relay installation position

### Remedy:

Check connection and rear spoiler relay (K115/1) in left rear trunk in rear SAM and repair as needed.

Note: Relay is not in relay slot but instead lying loosely in the wiring harness a piece of foam material (see picture).

Symptoms
Body / Special-purpose vehicles / Customer request / Nonfunctional

Control unit/fault code		
Control unit	Fault code	Fault text
N93/9 - AMG gateway (AMG GW) (DRVU_PROF)	B1EC311	Multifunction input 5 has a malfunction. There is a short circuit to ground.
N93/9 - AMG gateway (AMG GW) (DRVU_PROF)	B1EC211	Multifunction input 4 has a malfunction. There is a short circuit to ground.

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			5160F 74	