

## Window lifter reverses direction

---

Topic number	LI72.40-P-065509
Version	1
Design group	72.40 Door control
Date	01-09-2017
Validity	MODEL 205/253
Reason for change	
Reason for block	

---

### Complaint:

Window lifter reverses direction on reaching upper closing end position.

In Xentry Diagnostics (XD) the power window system is shown as "normalized".

### Path in XD:

XD => Control units view => DCU-xx => Actual values => Power windows => Normalization of power window

### Cause:

Software parameter in door control unit (DCU-xx).

### Remedy:

Remedy in preparation.

In the event of complaints, and until such time as the repair software becomes available, the power window system must be denormalized using XD and then renormalized again.

### Path in XD (denormalization/normalization):

- XD => Control units view => DCU-xx => Actuators => Power windows => Denormalization of power window
- XD => Control units view => DCU-xx => Adaptations => Teach-in processes => Normalization of power window

The repair software is expected to be available in 03/2017.

Note: Parts replacement will not remedy this complaint!

<b>Symptoms</b>
Body / Glazing / Window lifting mechanism/window operation / Remains stationary
Body / Glazing / Window lifting mechanism/window operation / Does not run up
Body / Glazing / Window lifting mechanism/window operation / Stiff/sluggish
Body / Glazing / Window lifting mechanism/window operation / Opens by itself

# XENTRY TIPS

---

Control unit/fault code		
Control unit	Fault code	Fault text
N69/1 - Left front door (DCU-LF) (DMFL222) (C (205))	-	-
N69/2 - Right front door (DCU-RF) (DMFR222) (C (205))	-	-
N69/3 - Left rear door (DCU-LR) (DMRL222) (C (205))	-	-
N69/4 - Right rear door (DCU-RR) (DMRR222) (C (205))	-	-

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			72220 GR	
			72230 GR	
			73A30 GR	
			73N30 GR	
54-0650				
54-1011				
54-0992				