

## Variable rear spoiler occasionally fails to extend or retract.

---

Topic number	LI77.25-P-063997
Version	3
Design group	77.25 Wind deflector (spoiler)
Date	01-24-2017
Validity	MODEL 190.###
Reason for change	Part number added
Reason for block	

---

### Complaint:

Variable rear spoiler occasionally fails to extend or retract.

### Cause:

Intermittent relay contacts.

Attachments	
File	Description
Position_Relais.jpg	Relay installation position

### Remedy:

Check connection and rear spoiler relay (K115/1) in left rear trunk in rear SAM.

Note: Relay is not in relay slot but instead lying loosely in the wiring harness in a piece of foam material (see picture).

Symptoms
Body / Special-purpose vehicles / Customer request / Nonfunctional

Control unit/fault code		
Control unit	Fault code	Fault text
N93/9 - AMG gateway (AMG GW) (DRVU_PROF)	B21E014	Multifunction output 6 has a malfunction. There is a short circuit to ground or an open circuit.
N93/9 - AMG gateway (AMG GW) (DRVU_PROF)	B21CF14	Multifunction output 3 has a malfunction. There is a short circuit to ground or an open circuit.

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 002 542 95 19			Relay	1		X

# XENTRY TIPS

## Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			5160F 74	

## Attachments

Position\_Relais.jpg:

