

## Collision Prevention Assist warns without obvious cause

Topic number	LI30.30-P-055823
Version	1
Design group	30.30 Cruise control (CC), DISTRONIC (DTR)
Date	03-04-2013
Validity	X166 with code 252 (Collision Prevention Assist CPA)
Reason for change	
Reason for block	

**Complaint:**

Collision Prevention Assist may warn without any obvious reason (optical and acoustic warning message).

**Cause:**

Offset value of short range sensor

**Remedy:**

Reprogram offset values of short range sensor

(Diagnosis >Control unit > Control unit SG-AWF (A90) > Adaptations > Teach-in processes > Component offset value > Start of procedure).

To this end, XENTRY version 01/2013 and add-on 2694 must be installed.

<b>Symptoms</b>
Communication/information / Warning and control system / COLLISION PREVENTION ASSIST / Warning message in instrument cluster

<b>Work units</b>				
Op. no.	Operation text	Time	Damage code	Note
			54W10 90	

<b>Validity</b>		
Vehicle	Engine	Transmission
GL (166)	*	*

<b>Full model designation breakdown</b>		
Vehicle	Engine	Transmission
166.823	642.826	722.903

# XENTRY

166.823	642.826	725.031
166.824	642.826	722.903
166.824	642.826	725.031
166.872	278.928	722.909
166.872	278.928	725.031
166.872	278.928	725.032
166.873	278.928	722.909
166.873	278.928	725.031
166.873	278.928	725.032
166.874	157.982	722.905
166.874	157.982	722.931